

Synergy Series

380 and 381 Digital Weight Indicators

Technical Manual



380 Synergy Series Digital Weight Indicator



381 Synergy Series Digital Weight Indicator



© Rice Lake Weighing Systems. All rights reserved.

Rice Lake Weighing Systems® is a registered trademark of
Rice Lake Weighing Systems.

All other brand or product names within this publication are trademarks or
registered trademarks of their respective companies.

All information contained within this publication is, to the best of our knowledge, complete and
accurate at the time of publication. Rice Lake Weighing Systems reserves the right to make
changes to the technology, features, specifications and design of the equipment without notice.

The most current version of this publication, software, firmware and all other product
updates can be found on our website:

www.ricelake.com

Revision History

This section tracks and describes manual revisions for awareness of major updates.

Revision	Date	Description
D	August 10, 2022	Revision history established; clarified configuration section and general formatting updates.
E	November 3, 2022	Added cord grip diameter ranges.
F	April 19, 2023	Added the 381 indicators to the manual.
G	August 16, 2023	Added clarifying note about startup

Table i. Revision Letter History



Technical training seminars are available through Rice Lake Weighing Systems. Course descriptions and dates can be viewed at www.ricelake.com/training or obtained by calling 715-234-9171 and asking for the training department.

Contents

1.0	Introduction	7
1.1	Safety	7
1.2	Options	8
1.3	Operating Modes	8
1.4	FCC Compliance	8
2.0	Installation	9
2.1	Unpacking	9
2.2	380 Product Dimensions	9
2.3	381 Product Dimensions	10
2.4	Mounting Instructions	10
2.5	Open Enclosure	11
2.5.1	380 Front Plate Removal	11
2.5.2	381 Back Plate Removal	12
2.6	Cord Grip Connections	13
2.6.1	380 Cord Grip Connections (PN 202711)	13
2.6.2	381-2D-AA Cord Grip Connections (PN 215695)	14
2.6.3	381-2D-NiMH Cord Grip Connections (PN 185064)	14
2.7	380 Cable Shield Grounding	15
2.8	CPU Board Connections	16
2.8.1	Load Cell Cable	16
2.8.2	380 RS-232 Serial Communications	16
2.9	Power Connections	17
2.9.1	380-2D Power Connections	17
2.9.2	381-2D-AA Power Connections	18
2.9.3	381-2D-NiMH Power Connections	18
2.10	Reassembly	19
2.10.1	380 Front Plate Reattachment	19
2.10.2	381 Reassembly	19
2.11	380 Parts Kit Components	20
2.12	Replacement Parts	21
3.0	Operation	24
3.1	Front Panel	24
3.2	LCD Annunciators	25
3.3	General Navigation	25
3.3.1	Numeric Value Entry	26
3.3.2	Alphanumeric Entry	26
3.4	Weigh Mode Operation	27
3.4.1	Zero Scale	27
3.4.2	Print Ticket	27
3.4.3	Toggle Units	27
3.4.4	Toggle Gross/Net Mode	27
3.4.5	Acquire Tare	27
3.4.6	Remove Tare Value	27
3.4.7	Preset Tare (Keyed Tare)	27



Rice Lake continually offers web-based video training on a growing selection of product-related topics at no cost. Visit www.ricelake.com/webinars

3.5	User Mode Menu	28
3.5.1	Display a Stored Tare	28
3.5.2	Clear a Stored Tare	28
3.5.3	View Legally Relevant Version	28
3.5.4	Display Accumulator	28
3.5.5	Print Accumulator	29
3.5.6	Clear Accumulator	29
3.6	Reset (Default) Configuration	29
4.0	Configuration	30
4.1	Seal the Indicator	30
4.1.1	Close the CAL Jumper	30
4.1.2	Seal the 380	31
4.1.3	Seal the 381	31
4.2	Main Menu	32
4.3	Setup Menu	32
4.3.1	Setup – Configuration Menu	33
4.3.2	Setup – Format Menu	34
4.3.3	Setup – Calibration Menu	34
4.3.4	Setup – Communication Menu	35
4.3.5	Setup – Program Menu	36
4.3.6	Setup – Print Format Menu	37
4.3.7	Setup – Stream Format Menu	38
4.4	Accumulator Menu	38
4.5	Tare Menu	39
4.6	Audit Menu	39
5.0	Calibration	40
5.1	Front Panel Calibration	40
5.1.1	Span Calibration	40
5.1.2	Linear Calibration	41
5.2	Alternative Zero Calibrations	41
5.2.1	Last Zero	41
5.2.2	Temporary Zero	41
5.2.3	Rezero	41
5.3	EDP Command Calibration	42
6.0	Revolution	43
6.1	Connecting to the Indicator	43
6.2	Saving and Transferring Data	43
6.2.1	Saving Indicator Data to a Personal Computer	43
6.2.2	Downloading Configuration Data from PC to Indicator	43
7.0	EDP Commands	44
7.1	Key Press Commands	44
7.2	Reporting Commands	45
7.3	Reset Configuration Command	45
7.4	Parameter Setting Commands	45
7.5	USB Setting Commands	46
7.6	EDP Setting Commands	47
7.7	Stream Setting Commands	47



Technical training seminars are available through Rice Lake Weighing Systems. Course descriptions and dates can be viewed at www.ricelake.com/training or obtained by calling 715-234-9171 and asking for the training department.

7.8	Feature Commands	47
7.9	Print Format Commands	48
7.10	Weigh Mode Commands	48
8.0	Print Formatting	49
8.1	Print Formatting Tokens	49
8.2	Customizing Print Formats	50
8.3	Non-Human Readable Characters	50
9.0	Maintenance	51
9.1	Maintenance Checkpoints	51
9.2	Field Wiring	51
9.3	Troubleshooting	51
9.4	Board Replacement	52
9.5	Updating Firmware	52
9.5.1	With Revolution	52
9.5.2	Without Revolution	52
10.0	Appendix	53
10.1	Error Messages	53
10.2	ZZ EDP Command	53
10.3	Continuous Data (Stream) Output Formats	54
10.3.1	Rice Lake Weighing Systems Stream Format (RLWS)	54
10.3.2	Cardinal Stream Format (crdnl)	54
10.3.3	Avery Weigh-Tronix Stream Format (wtrnix)	55
10.3.4	Mettler Toledo Stream Format (toledo)	55
10.4	Conversion Factors for Secondary Units	56
10.5	Digital Filtering	56
10.5.1	Digital Rolling Average Filter (AVGONLY)	56
10.5.2	Regulatory Mode Functions	57
10.6	ASCII Character Chart	58
10.7	Front Panel Display Characters	59
11.0	Compliance	60
12.0	Specifications	62



Rice Lake continually offers web-based video training on a growing selection of product-related topics at no cost. Visit www.ricelake.com/webinars

1.0 Introduction

This manual is intended for use by service technicians responsible for installing and servicing 380/381 digital weight indicators. Configuration and calibration of the indicator can be accomplished using the Revolution® configuration utility or the indicator front panel keys. See [Section 4.0 on page 30](#) and [Section 5.0 on page 40](#) for information about configuration and calibration.



Manuals and additional resources are available from Rice Lake Weighing Systems at www.ricelake.com/manuals

Warranty information can be found on the website at www.ricelake.com/warranties

1.1 Safety

Safety Definitions:



DANGER: Indicates an imminently hazardous situation that, if not avoided, will result in death or serious injury. Includes hazards that are exposed when guards are removed.



WARNING: Indicates a potentially hazardous situation that, if not avoided, could result in serious injury or death. Includes hazards that are exposed when guards are removed.



CAUTION: Indicates a potentially hazardous situation that, if not avoided, could result in minor or moderate injury.



IMPORTANT: Indicates information about procedures that, if not observed, could result in damage to equipment or corruption to and loss of data.

General Safety



Do not operate or work on this equipment unless this manual has been read and all instructions are understood. Failure to follow the instructions or heed the warnings could result in injury or death. Contact any Rice Lake Weighing Systems dealer for replacement manuals.



WARNING

Failure to heed could result in serious injury or death.

Some procedures described in this manual require work inside the indicator enclosure. These procedures are to be performed by qualified service personnel only.

Ensure the power source is disconnected from the outlet before opening the unit.

Do not allow minors (children) or inexperienced persons to operate this unit.

Do not operate without the enclosure completely assembled.

Do not use for purposes other than weight taking.

Do not place fingers into slots or possible pinch points.

Do not use this product if any of the components are cracked.

Do not exceed the rated specification of the unit.

Only connect unit to equipment certified to IEC 60950, IEC 62368, IEC 61010 or similar.

Do not make alterations or modifications to the unit.

Do not remove or obscure warning labels.

Do not use solvents or aggressive substances to clean the indicator.

Do not submerge.

1.2 Options

The 380/381 Synergy indicator includes several factory installed options. Some features in this manual are not available in all models.

Synergy Series Models

Stainless Steel Model

- 380-2D (PN 202711) – Universal alkaline C-cell battery powered

Plastic Models

- 381-2D-AA (PN 215695) – Universal alkaline AA-cell battery powered
- 381-2D-NiMH (PN 215696) – Universal rechargeable nickel metal hydride battery powered

Available Options


- RTC Option (PN 204258) – Adds date and time functionality to the indicator; time is backed by an independent battery.

1.3 Operating Modes


Weigh Mode

Weigh mode is the default mode of the indicator. The indicator displays gross or net weights as required, using the annunciators to indicate scale status and the type of weight value displayed.

User Mode

User mode is accessible by pressing and holding  for five seconds on the front panel while in weigh mode. The indicator displays the audit, accumulator, tare and version menus when in user mode.

Setup Mode

Setup mode is accessible by pressing  momentarily on the front panel during power up. Most of the procedures described in this manual, including calibration, require the indicator to be in setup mode.

See [Section 4.0 on page 30](#) for the procedure to enter setup mode and the parameters available.

1.4 FCC Compliance

United States

This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference in which case the user will be required to correct the interference at his own expense.

Canada

This digital apparatus does not exceed the Class A limits for radio noise emissions from digital apparatus set out in the Radio Interference Regulations of the Canadian Department of Communications.

Le présent appareil numérique n'émet pas de bruits radioélectriques dépassant les limites applicables aux appareils numériques de la Class A prescrites dans le Règlement sur le brouillage radioélectrique édicté par le ministère des Communications du Canada.

2.0 Installation

This section describes procedures for connecting power, load cells and data communication cables to a 380/381 Synergy Series indicator. An assembly drawing and parts list are included for the service technician.



WARNING



*Risk of electrical shock.
Risque de choc.*



*Disconnect power before servicing.
Débranchez l'alimentation avant l'entretien.*



AVERTISSEMENT



CAUTION: Risk of explosion if battery is replaced by an incorrect type. Dispose of used batteries according to state and local regulations.



ATTENTION: Risque d'explosion si la batterie est remplacée par un type incorrect. Mettre au rebut les batteries usagées selon les règlements d'état et locaux.

Specified optional power adapters are the only external power sources allowed to be used for the 380/381 Synergy Series indicators.

- 380-2D – (PN 206433)
- 381-2D-AA – (PN 215734)
- 381-2D-NiMh – (PN 185064) The 381-2D-NiMh cannot be powered on with the adapter connected



IMPORTANT: Leaving the charger attached to the 381-2D-NiMh while not plugged in will discharge the battery even if the indicator is powered off.



WARNING: Failure to heed the following statements could result in serious injury or death.

- Procedures requiring work inside the product enclosure must be performed by qualified service personnel only.
- Use a grounding wrist strap to protect components from electrostatic discharge (ESD) damage when working inside the product enclosure.
- The power outlet must be near the equipment and must be easily accessible.

2.1 Unpacking

Immediately after unpacking, visually inspect the 380/381 to ensure all components are included and undamaged. The 380 shipping carton contains the indicator, this manual and a parts kit (Section 2.11 on page 20). The 381 shipping carton contains a power adapter, the stand and a quick start guide. If parts were damaged in shipment, notify Rice Lake Weighing Systems and the shipper immediately.

2.2 380 Product Dimensions

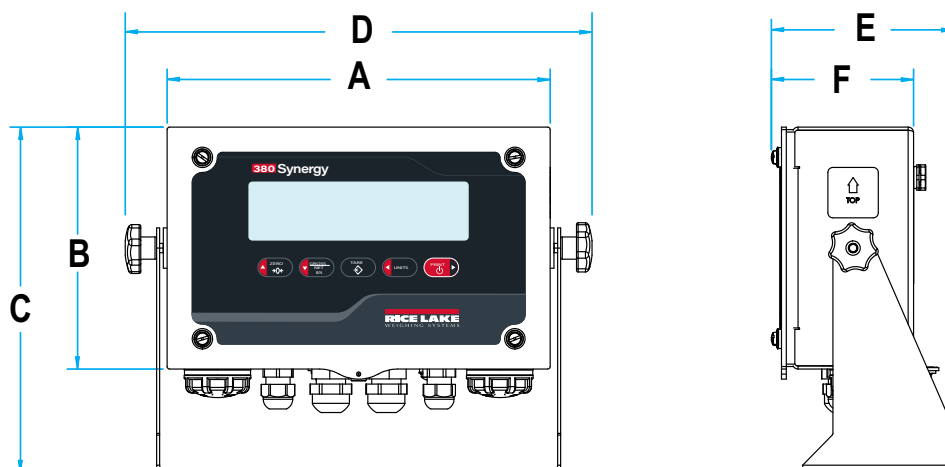


Figure 2-1. 380 Product Diagram

A	B	C	D	E	F
9.50 in (241 mm)	6.00 in (152 mm)	8.57 in (218 mm)	11.58 in (294 mm)	4.53 in (115 mm)	3.53 in (90 mm)

Table 2-1. 380 Product Dimensions

2.3 381 Product Dimensions

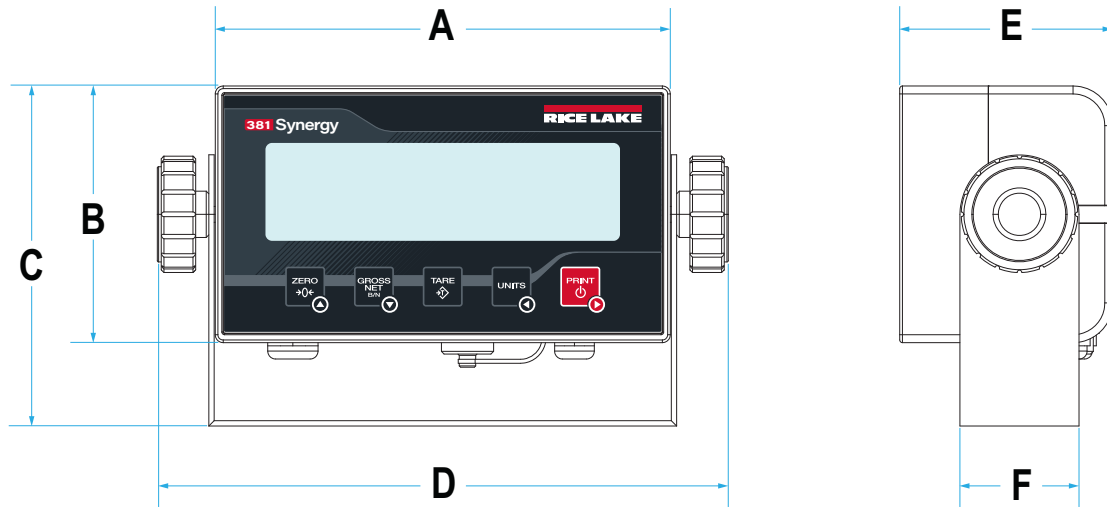


Figure 2-2. 381 Product Diagram

A	B	C	D	E	F
6.77 in (172 mm)	3.82 in (97 mm)	5.06 in (129 mm)	8.50 in (216 mm)	3.17 in (81 mm)	1.77 in (45 mm)

Table 2-2. 381 Product Dimensions

2.4 Mounting Instructions

All 380/381 Synergy Series indicators include a universal mount stand. The 380 universal mount stand has 4 holes and the 381 stand has two holes. The stand can be mounted on a wall, tabletop or a flat surface. The instructions below are to be used as an example for all models.



NOTE: The universal mount stand comes attached to the 380. Rice Lake Weighing Systems recommends removing the indicator from the stand prior to mounting.

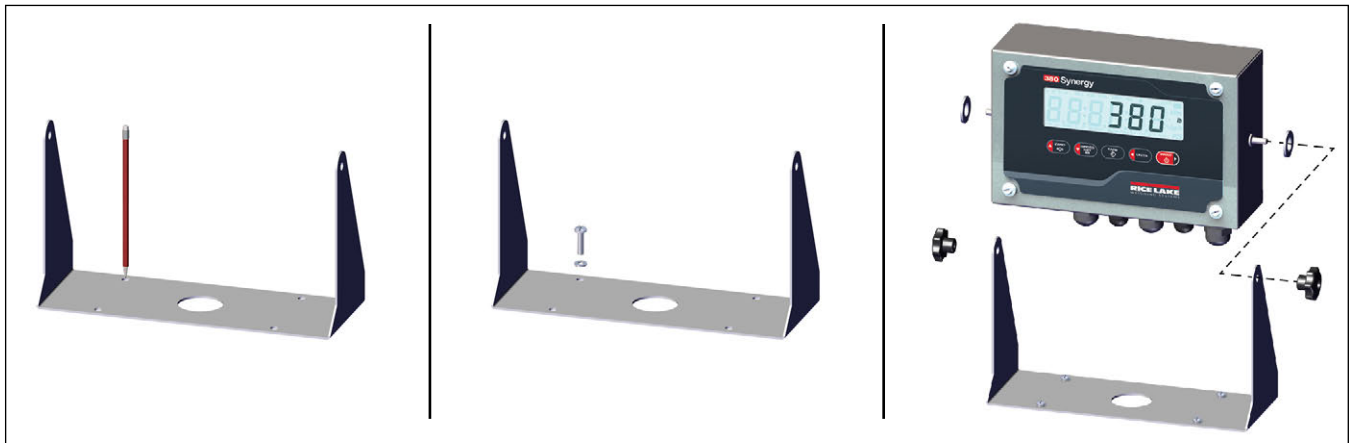


Figure 2-3. Mounting the Indicator

1. Using the mount as a template, mark the screw locations.
2. Drill holes for the screws.
3. Secure the universal mount using the appropriate length 1/4 in or M6 hardware (not included).
4. Reattach the 380/381 to the universal mount stand.



NOTE: The 380 parts kit includes rubber grommets to insert into the four screw holes of the universal mount stand for a non-mounted application.

2.5 Open Enclosure

This section includes information on opening the 380 and 381 enclosures.

2.5.1 380 Front Plate Removal

Remove the front plate of the 380 to connect cables and to gain access to the 380 board.



WARNING: Before opening the unit, ensure batteries are removed and the optional power cord is disconnected from the power outlet.

1. Place the indicator face-up on an anti-static work mat.
2. Remove the screws holding the front plate to the enclosure.
3. Lift the front plate away from the enclosure and disconnect the ground wire from the front plate.

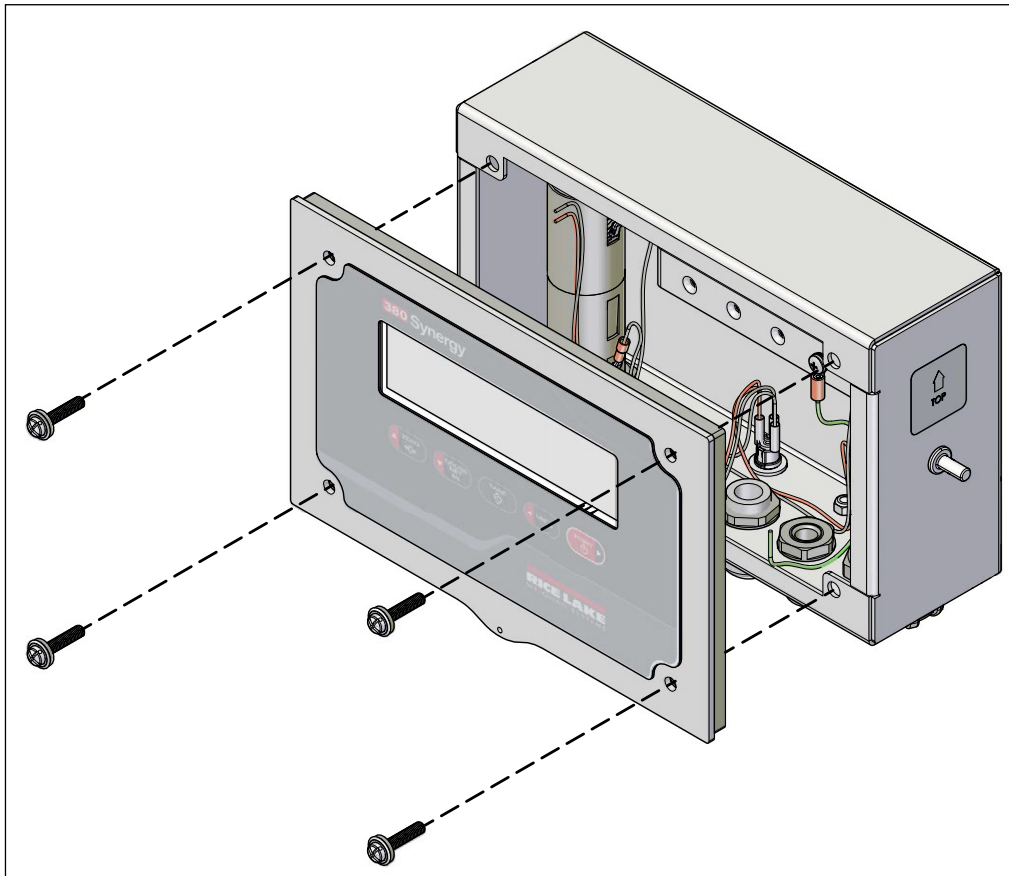


Figure 2-4. Removing the Front Plate

380 Torque Ratings

Refer to [Table 2-3](#) throughout installation and use of product to maintain proper torque ratings for 380 components.

Component	Torque Rating
Front Plate Screw	10 in-lb (1.1 N-m)
Cord Grip Nut (to enclosure)	33 in-lb (3.7 N-m)
Cord Grip Dome Nut (around cable)	22 in-lb (2.5 N-m)
Screw at Antenna Hole	10 in-lb (1.1 N-m)
Grounding wire	10 in-lb (1.1 N-m)
Standoff Nuts	4 in-lb (0.45 N-m)

Table 2-3. Component Torque Ratings

2.5.2 381 Back Plate Removal

Remove the back cover of the 381 to connect cables and to gain access to the 381 board.



WARNING: Before opening the unit, ensure power cord is disconnected from the power outlet.

1. Place the indicator face-down on an anti-static work mat.
2. Remove the screws holding the back cover to the enclosure with a 3mm hex key (PN 216647).
3. Lift the back cover away from the enclosure.

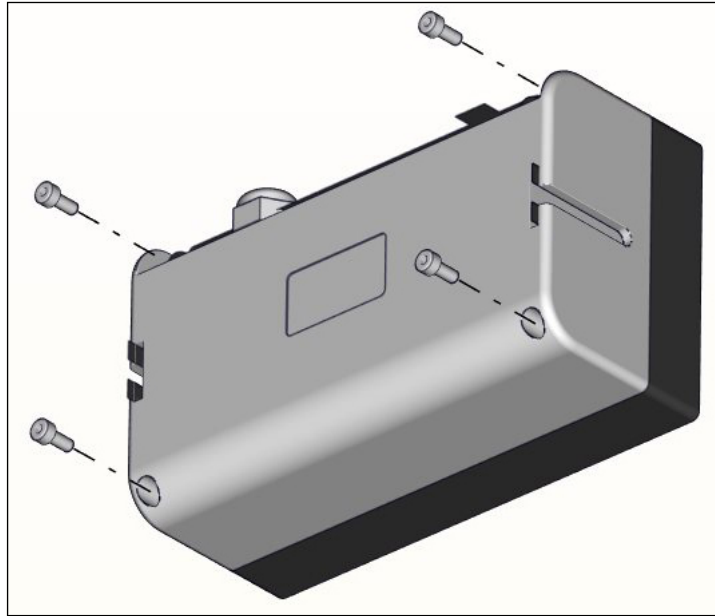


Figure 2-5. Removing the Back Plate

381 Torque Ratings

Refer to [Table 2-4](#) throughout installation and use of product to maintain proper torque ratings for 381 components.

Component	Torque Rating
Back Cover Screw	13 in-lb (1.5 N-m)
Cord Grip Nut (to enclosure)	33 in-lb (3.7 N-m)
Cord Grip Dome Nut (around cable)	22 in-lb (2.5 N-m)
Standoff Nuts	4 in-lb (0.45 N-m)

Table 2-4. Component Torque Ratings

2.6 Cord Grip Connections

Each of the models in the 380/381 Synergy Series indicator line utilizes a different cord grip configuration. Cable plugs for the 380 are included in the parts kit and must be installed in open cord grips to prevent moisture from entering the enclosure. Depending on the application, install cables as required. 381 cord grip plugs are already installed. The recommended cable strip length is 0.25 in (7 mm) for all 380/381 connectors.



WARNING: Only connect unit to equipment certified to IEC 60950, IEC 62368, IEC 61010 or similar.



IMPORTANT: Do not have open/bare wires outside of the enclosure. Make sure no stripped portion of cable is on the outside of the cord grips.

IMPORTANT: Properly seal cord grips to prevent moisture damage inside of the enclosure. Cable plugs must be installed in unused cord grips. Cord grip dome nuts, around a cable or a plug, must be torqued to 22 in-lb. The cord grip nut against the enclosure must be torqued to 33 in-lb.

Cable Diameter Ranges

Refer to [Table 2-5](#) for minimum and maximum cable sizes for use with cord grips.

Cord Grip	Diameter Range
PG7 (PN 58983)	0.098 - 0.256 in (2.5 - 6.5mm)
PG9 (PN 15626)	0.138 - 0.315 in (3.5 - 8mm)
PG11 (PN 68600)	0.197 - 0.394 in (5 - 10 mm)

Table 2-5. Cord Grip Diameter Ranges

2.6.1 380 Cord Grip Connections (PN 202711)

The 380 provides four cord grips at the bottom of the enclosure for cabling into the indicator. One of the cord grips is used for the load cell and the other three are used to accommodate the serial connection and other future connections. See [Figure 2-6](#) for the recommended assignments for the 380 cord grips.

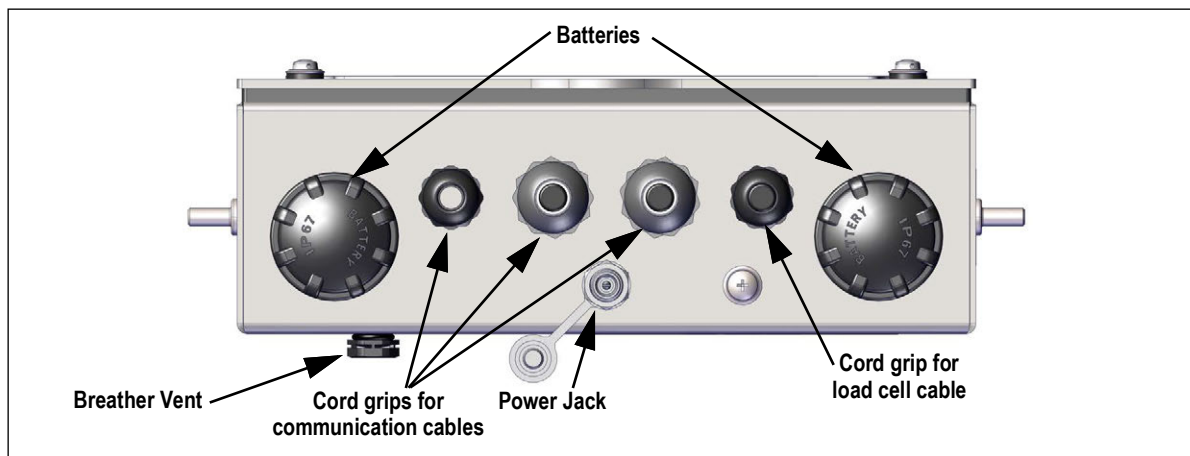


Figure 2-6. Recommended Cord Grip Assignments

2.6.2 381-2D-AA Cord Grip Connections (PN 215695)

The 381-2D-AA provides one cord grip, a power jack and an RJ11/12 jack at the bottom of the enclosure for cabling into the indicator. The cord grip is used for the load cell and the other connections are for power and serial connection. See [Figure 2-7](#) for the recommended assignments for the 381-2D-AA connections.

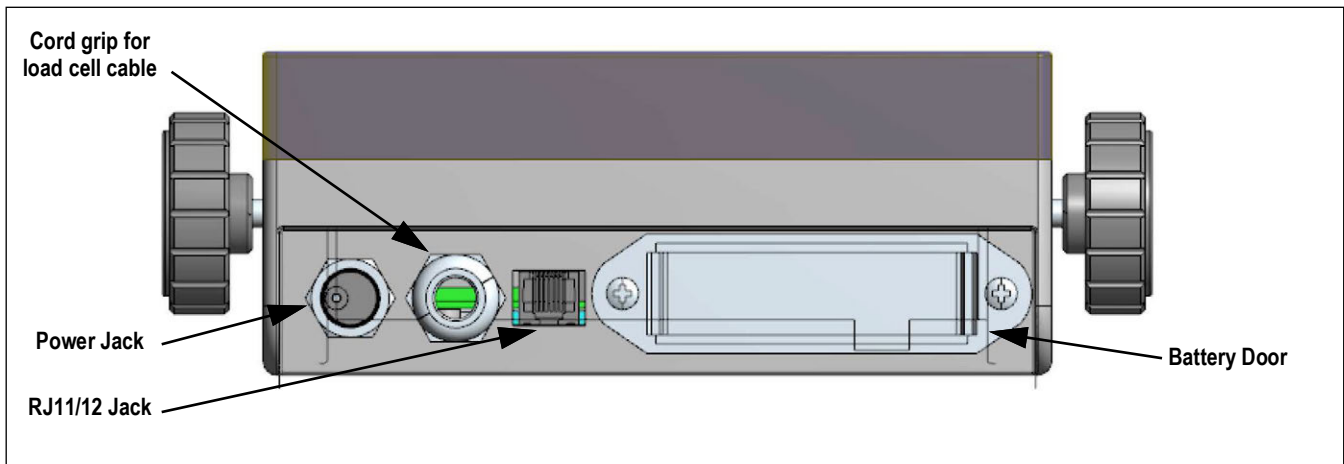


Figure 2-7. Recommended Connection Assignments

2.6.3 381-2D-NiMH Cord Grip Connections (PN 185064)

The 381-2D-NiMH provides two cord grips and two other connections at the bottom of the enclosure for cabling into the indicator. One of the cord grips is used for the load cell and the other three connections are used to accommodate the serial connection, the battery charger and other future connections. See [Figure 2-8](#) for the recommended assignments for the 381-2D-NiMH connections.



WARNING: Only connect unit to equipment certified to IEC 60950, IEC 62368, IEC 61010 or similar.



IMPORTANT: Removal of the RJ-11/12 cover and the charger cap invalidate the IP rating of the unit.

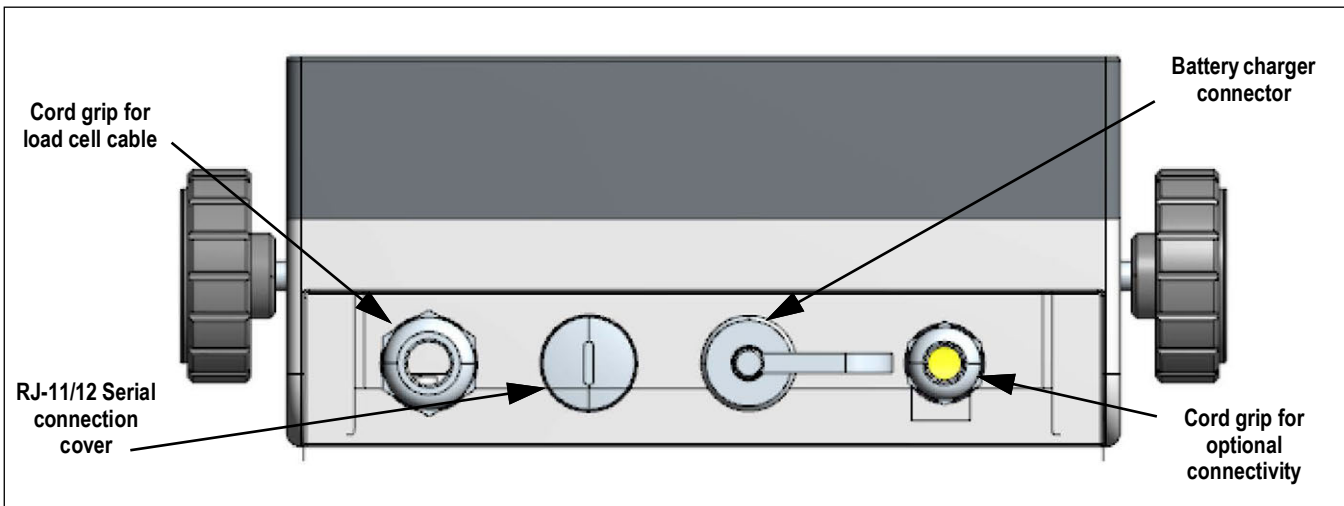


Figure 2-8. Recommended Connection Assignments

2.7 380 Cable Shield Grounding

All cables routed through the cord grips on the 380 must be shield grounded against the grounding rail in the enclosure.

- Use M4 screws provided in the parts kit to install shielding clamps on the grounding rail at the back of the enclosure
- Install only the necessary amount of shielding clamps for the cord grips to be used
- Remove the insulated jackets and shielding per the following instructions

Shielding Procedure

1. Install the shielding clamps on the grounding rail using the clamp screws. Finger tighten the screws at this time.
2. Route the cables through the cord grips and the shielding clamps to determine the cable lengths required to reach the appropriate cable connectors.
3. Mark cables to remove the insulated jacket as described below for Foil Shielded Cables and Braid Shielded Cables.

Foil Shielded Cables

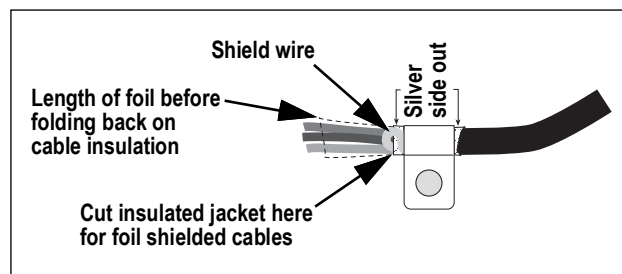


Figure 2-9. Foil Shielded Cable

1. Strip the insulated jacket and foil 1/2 in (15 mm) past the shielding clamp.
2. Strip another 1/2 in of the insulated jacket, leaving the foil shielding exposed.
3. Fold the foil shielding back on the cable where the cable passes through the clamp.
4. Ensure the silver (conductive) side of the foil is turned outward.
5. Wrap the shield wire around the cable, ensuring it contacts the foil where the cable passes through the clamp.
6. Torque the shielding clamp screw to 10 in-lb (1.1 N-m), ensuring the clamp is around the cable and contacting the shield wire.

Braid Shielded Cables

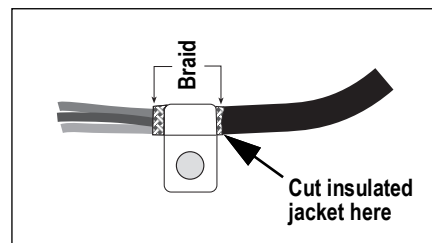


Figure 2-10. Braid Shielded Cable

1. Strip the insulated jacket and braided shielding from a point just past the shielding clamp.
2. Strip another 1/2 in (15 mm) of the insulated jacket, leaving the braid exposed where the cable passes through the clamp.
3. Torque the shielding clamp screw to 10 in-lb (1.1 N-m), ensuring the clamp is contacting the braided shielding of the cable.



NOTE: The recommended cable strip length is 0.25 in (7 mm) for all 380/381 connectors.

2.8 CPU Board Connections

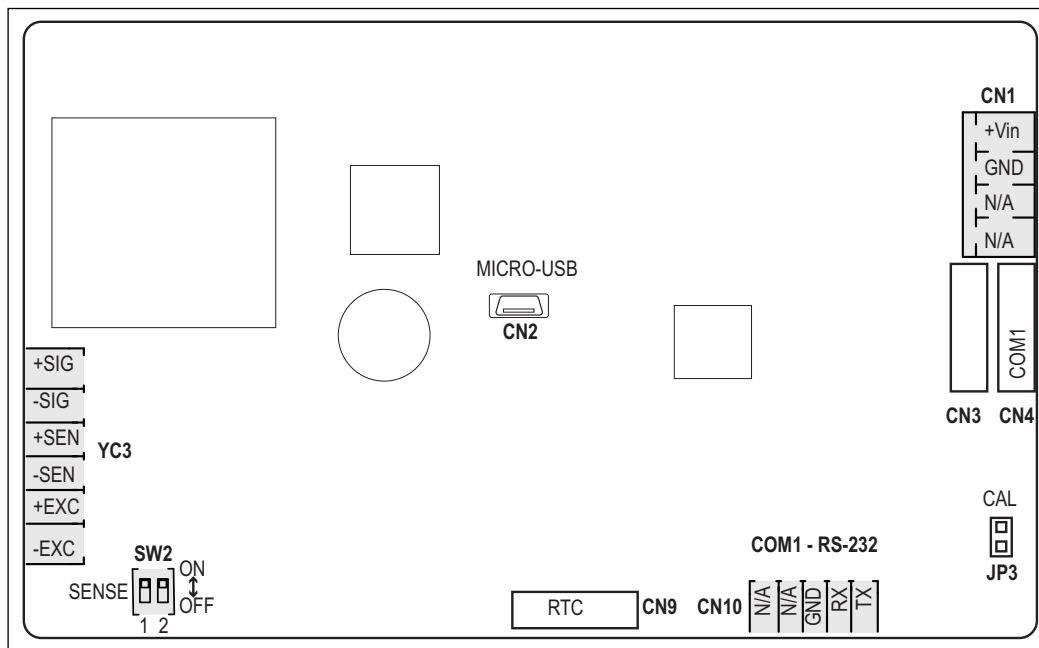


Figure 2-11. CPU Board Connections

2.8.1 Load Cell Cable

To attach the cable from a load cell or junction box, route cable to the YC3 connector. See [Table 2-6](#) for wiring the load cell cable from the load cell or junction box to connector.

Connector	Pin	Function
YC3	1	+SIG
	2	-SIG
	3	+SEN
	4	-SEN
	5	+EXC
	6	-EXC

Table 2-6. YC3 Pin Assignments (Load Cell)



NOTE: For a 4-wire installation leave pins 3 and 4 empty on the connector.

NOTE: For a 6-wire installation set SW2 to all positions “off”, for 4-wire installation set all positions to “on.”

2.8.2 380 RS-232 Serial Communications

The CN10 connector is intended to provide a connection point for the RS-232 serial communications. One RS-232 port is available. See [Table 2-7](#) for the pin assignments for the CN10 connector.

Connector	Pin	RS232
CN10	1	TX1
	2	RX1
	3	GND
	4	N/A
	5	N/A

Table 2-7. CN10 Pin Assignments (RS-232)



NOTE: This connection is available on the outside of the 381 enclosure via an RJ11/12 connector and optional cable. (PN 215273). The serial connection can be made directly to the CN10 if the RJ-11/12 connection is not wanted.

2.9 Power Connections

Power is connected to the power supply and the CPU board through the power harness.

Connector	Pin	Wire	Power
CN1	1	Red	+Vin
	2	Black	GND
	3	N/A	N/A
	4	N/A	N/A

Table 2-8. CN1 Alkaline Battery Pin Assignments (Power Supply)

2.9.1 380-2D Power Connections

The 380 Synergy Indicator is powered by 4 C-Cell Batteries or an optional 12 V adapter (PN 206433). When the adapter is inserted into the power jack, indicator power is disconnected from the battery holders and batteries no longer drain. The Power adapter does not charge the batteries.



NOTE: Optional power adapter (PN 206433) is the only external power source allowed to be used.

NOTE: Ensure that battery covers are screwed finger tight. If covers are not fully screwed on, the indicator will not function.

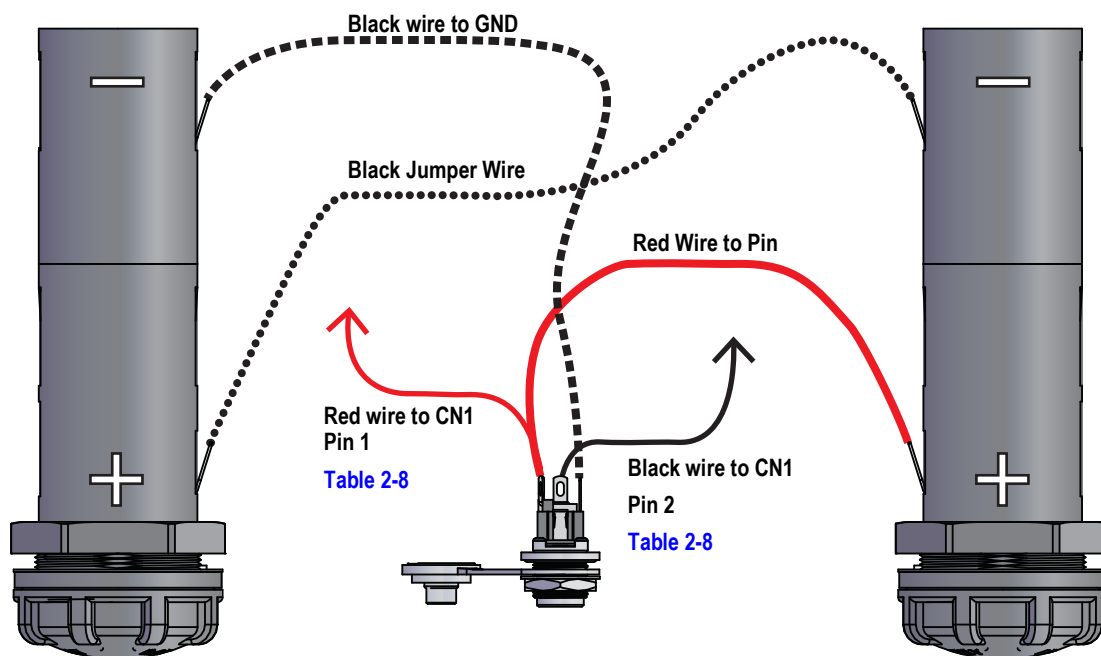


Figure 2-12. 380-2D Battery Cell Wiring

2.9.2 381-2D-AA Power Connections

The 381-2D-AA Synergy Indicator is powered by 4 AA Batteries or an optional 12 V adapter (PN 215734). When the adapter is inserted into the power jack, indicator power is disconnected from the battery holders and batteries no longer drain. The power adapter does not charge the batteries.

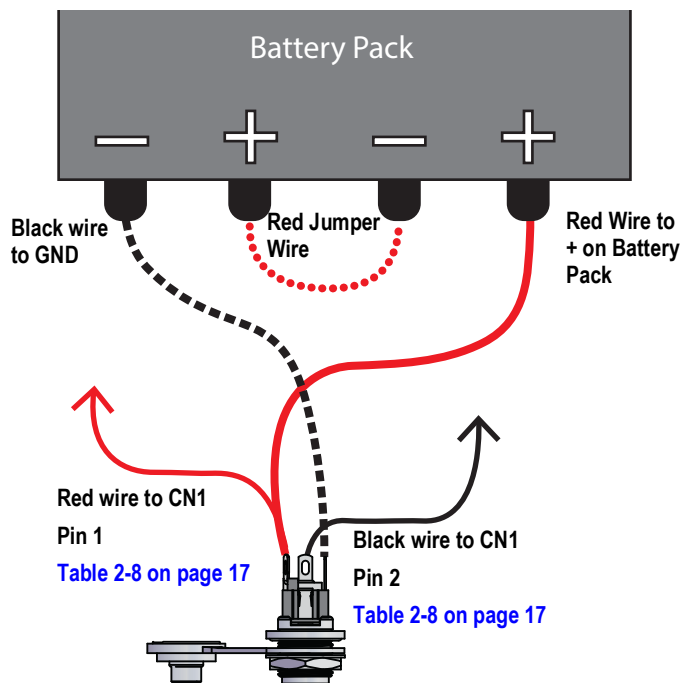


Figure 2-13. 381-2D-AA Battery Cell Wiring

2.9.3 381-2D-NiMH Power Connections

The 381-2D-NiMH Synergy Indicator is powered by a rechargeable NiMH battery. The Power adapter (PN 185064) charges the battery.



IMPORTANT: The 381-2D-NiMH must not be powered on while battery is charging.

Leaving the charger attached to the 381-2D-NiMH while not plugged in will discharge the battery even if the indicator is powered off.

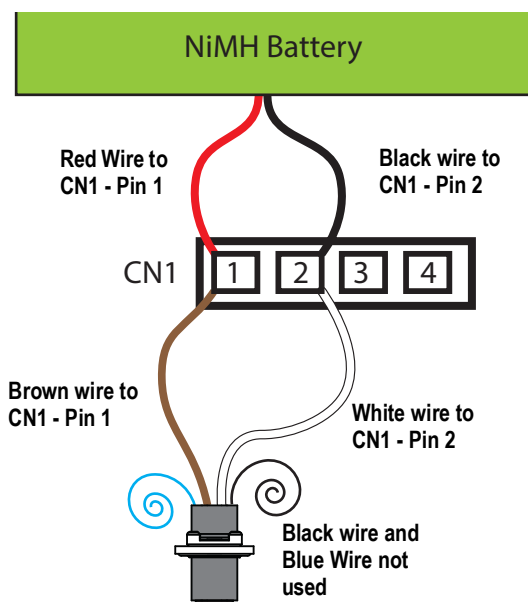


Figure 2-14. 381-2D-NiMH Battery Cell Wiring

2.10 Reassembly

Once work inside of the enclosure is complete, reattach the front plate ground wire to the front plate.

2.10.1 380 Front Plate Reattachment

Position the front plate over the enclosure and install the four front plate screws with a Philips head screw driver. Use the torque pattern in [Figure 2-15](#) to prevent distorting the front plate gasket. Torque screws to 10 in-lb (1.1 N-m).

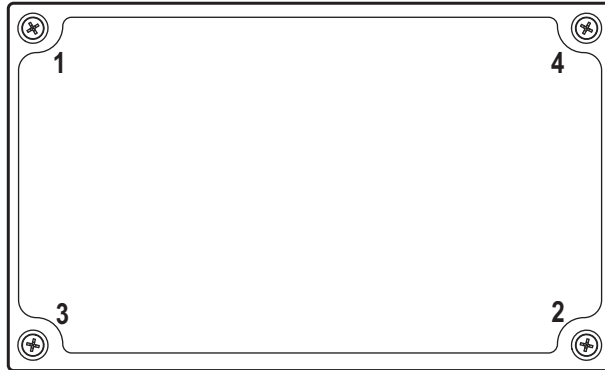


Figure 2-15. 380 Front Plate Torque Pattern



NOTE: Torqued screws may become less tight as the gasket is compressed during the torque pattern; a second torque is required using the same pattern and torque value.

2.10.2 381 Reassembly

Position the Back cover over the enclosure and install the four screws with a 3mm hex key (PN 216647). Use the torque pattern in [Figure 2-16](#) to prevent distorting the gasket on the 381-2D-NiMH. Torque screws to 13 in-lb (1.5 N-m).

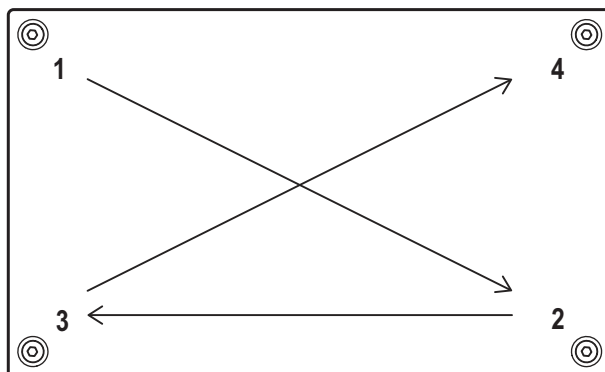


Figure 2-16. 381 Torque Pattern



NOTE: Torqued screws may become less tight as the gasket is compressed during the torque pattern; a second torque is required using the same pattern and torque value.

2.11 380 Parts Kit Components

Part No.	Description	Qty.
108945	SCREW, M3 x 0.5 x 8 mm Phillips Flat Countersunk Stainless Steel Machine Screw	1
15631	CABLE TIE, 3 in Nylon	4
15650	MOUNT, 3/4 in Cable Tie Mount	2
15664	GLAND, Reducing 9 mm-3/8NPT	2
192586	FRAME, Jumper Protection	1
19538	POST PLUG, 1/4 in x 1.00 Slotted Black Plastic	3
202140	SCREW, M4 x 0.7 x 10 Phillips Pan Head Zinc Finish Steel SEMS Screw with External Tooth Washer	3
28325	BAG, 2 x 3 2-Mil Write On, Ziploc Style Plastic Bag	1
30632	BAG, 5 x 8 2-Mil Ziploc Style Plastic Bag	1
42149	BUMPER, 0.50 OD x 0.281 ID Rubber Grommet	4
53075	CLAMP, Ø0.078 in Ground Cable Shield	4
67550	CLAMP, Ø0.125 in Ground Cable Shield	2
94422	LABEL, 0.40 x 5.00 Capacity Label	1

Table 2-9. 380 Parts Kit (PN 205840) Components

2.12 Replacement Parts

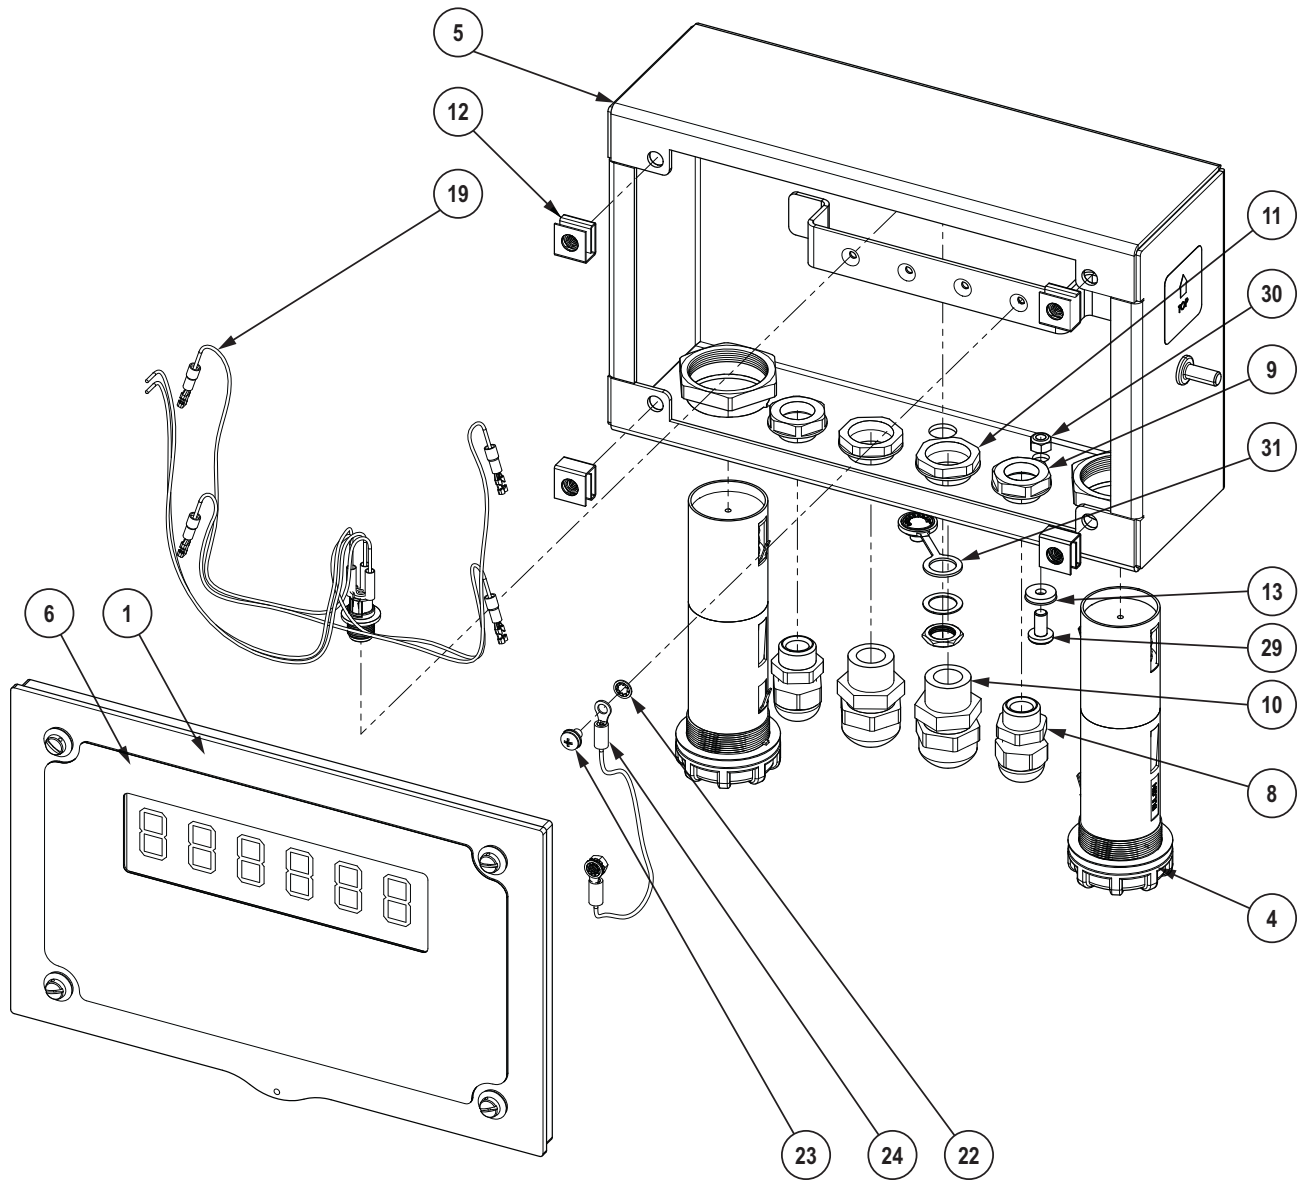


Figure 2-17. 380 Replacement Parts Diagram – Front View

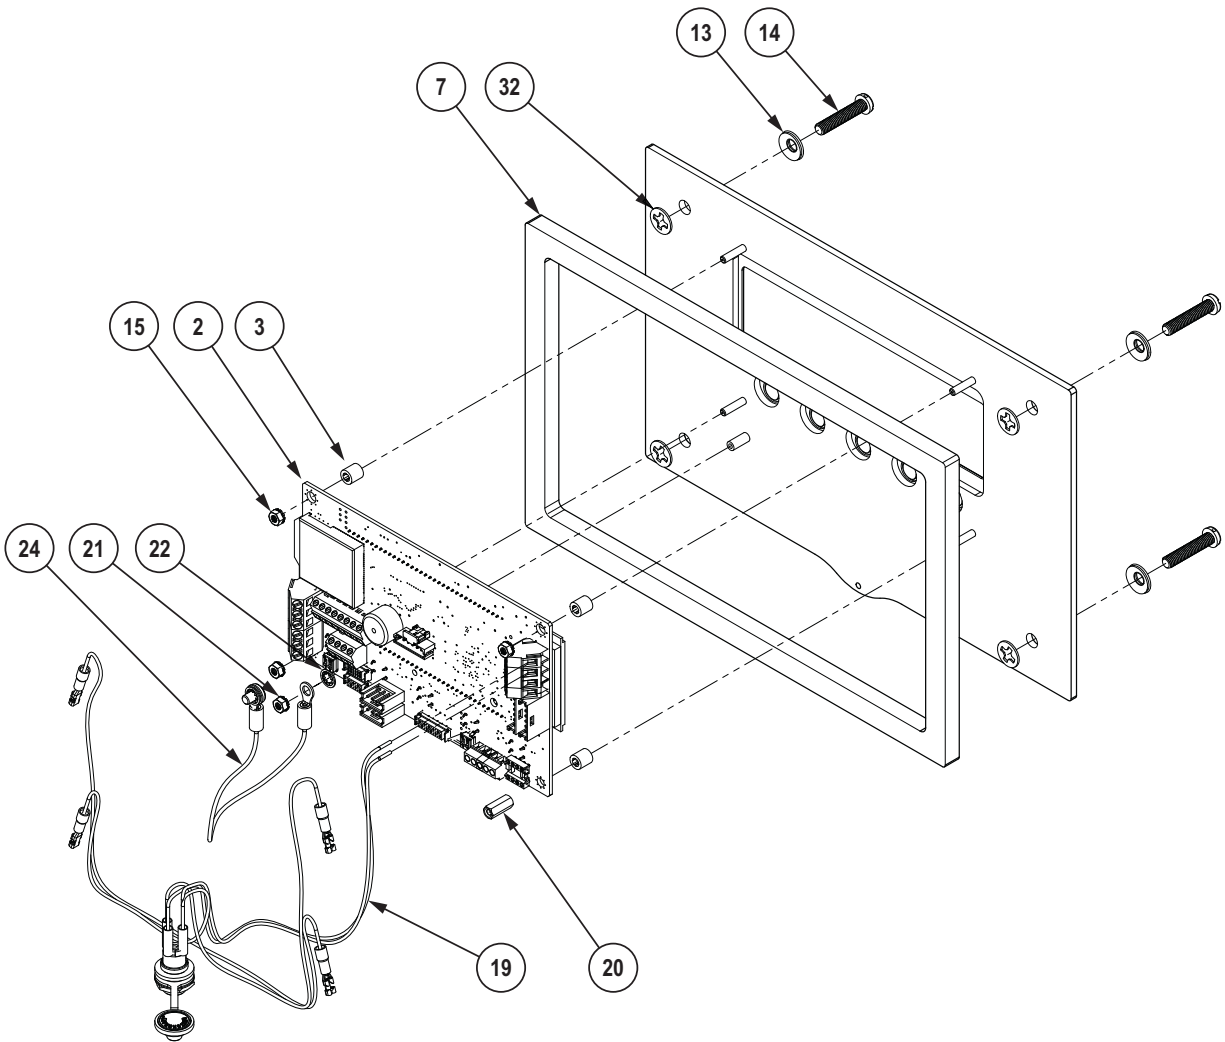


Figure 2-18. 380 Replacement Parts Diagram – Rear View

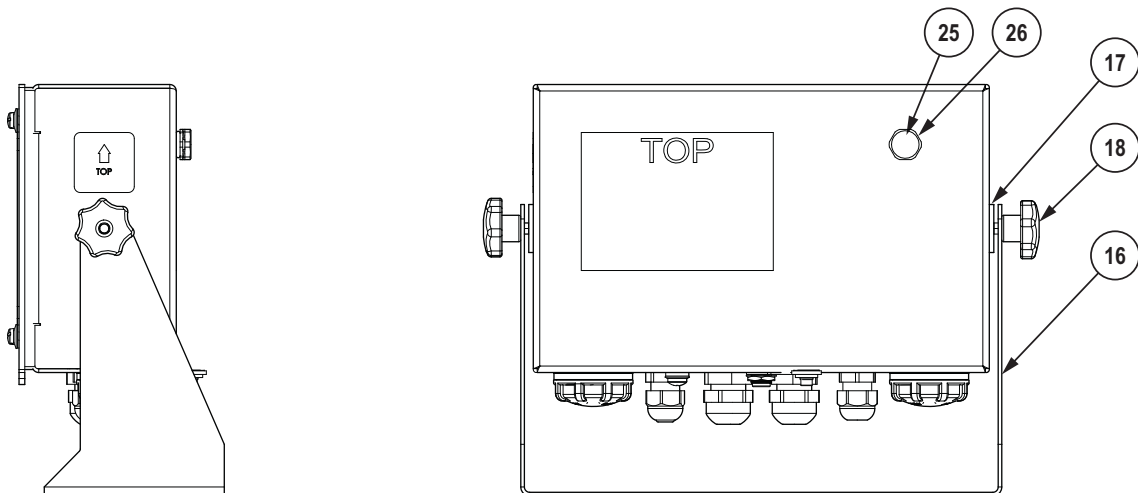


Figure 2-19. 380 Replacement Parts Diagram – Side View

Item No.	Part No.	Description	Qty.
1	201041	FRONT COVER, 380 Universal Battery Powered	1
2	206406	BOARD ASSEMBLY, Replacement 380 CPU, RoHS Compliant	1
3	202064	SPACER, M3 x Ø0.250 x 0.260 Round Nylon	4
4	205136	HOLDER, BATTERY 2C, C-Size Battery Holder, Front Panel, IP67	2
5	201040	ENCLOSURE, 380 Universal Battery Powered	1
6	202824	OVERLAY, 380 Synergy Indicator	1
7	203691	GASKET, 380 Synergy Battery Powered Indicator	1
8	15626	CORD GRIP, PG9 Plastic	2
9	15627	LOCKNUT, PG9 Plastic	2
10	68600	CORD GRIP, PG11	2
11	68601	NUT, PG11 Black Nylon	2
12	205800	NUT, M5 x 0.8 Clip on Floating Hex Zinc Plated	4
13	46381	WASHER, #10 18-8 Bonded Sealing Stainless Steel	5
14	205687	SCREW, M5 x 0.8 x 25 mm Phillips Drilled Cheese Head Stainless Steel Machine Screw	4
15	202061	NUT, M3 x 0.5 Hex Kep Stainless Steel	3
16	29635	STAND, Stainless Steel Tilt	1
17	103988	WASHER, 0.515-0.52 Nylon	2
18	180825	KNOB, 32 mm Diameter, Nylon Knob, M6 x 1 Threaded Thru, Stainless Steel	2
19	204557	CABLE ASSEMBLY, 380 Synergy Power Harness	1
20	205753	STANDOFF, M3 x 0.5 x 12 mm F/F Nickel Plated Brass	1
21	180826	NUT, M4 x 0.7 Kep Nut with 18-8 Stainless Steel External Tooth Lock Washer	1
22	180856	WASHER, M4 Internal Tooth Stainless Steel	2
23	194488	SCREW, M4 x 0.7 x 6 Phillips Pan Head Zinc Finish Steel External Tooth Washer Sems Machine Screw	1
24	40672	WIRE, 9 in Ground Wire with #8 Eye Connector	1
25	88733	VENT, Black Plastic Gortex Sealed Breather	1
26	88734	NUT, M12 x 1 Thread Breather Vent	1
29	150800	SCREW, M5 x 0.8 x 10 Stainless Steel Phillips Pan Head Machine Screw	1
30	187876	NUT, M5 Nylon Insert Stainless Steel Lock Nut	1
31	205294	SEAL, Power Jack Seal Cap	1
32	205884	WASHER, M5 x 0.177 ID x 0.453 OD x 0.032 Nylon Self-Retaining	4

Table 2-10. 380 Replacement Parts

Part No.	Description
216778	CABLE ASSY, Power Harness 381 Synergy NiMH
216779	CABLE ASSY, Power Harness 381 Synergy AA
216780	TRAY, Removable, Batt Holder 381 Synergy AA
216781	BATTERY, NiMH, Internal 6 V 4.5 Ah, 381 Synergy
216782	BOARD ASSY, Serial RJ11 381 Synergy
216783	KNOB, Side 381 Synergy (black cap)
216784	INSERT, Side Knob 381 Synergy (metal insert)
216814	GASKET, Seal 381 Enclosure IP68 (381-2D-NiMH Only)

Table 2-11. 381 Replacement Parts

3.0 Operation

The front panel consists of a seven-segment LCD display with six 1.0 in (25 mm) tall digits. A negative number displays as five digits plus the negative symbol. The front panel also includes five flat panel keys, backed by tactile primary scale function buttons with an integrated power button. There are annunciators built into the LCD screen that show units and scale functions.

3.1 Front Panel

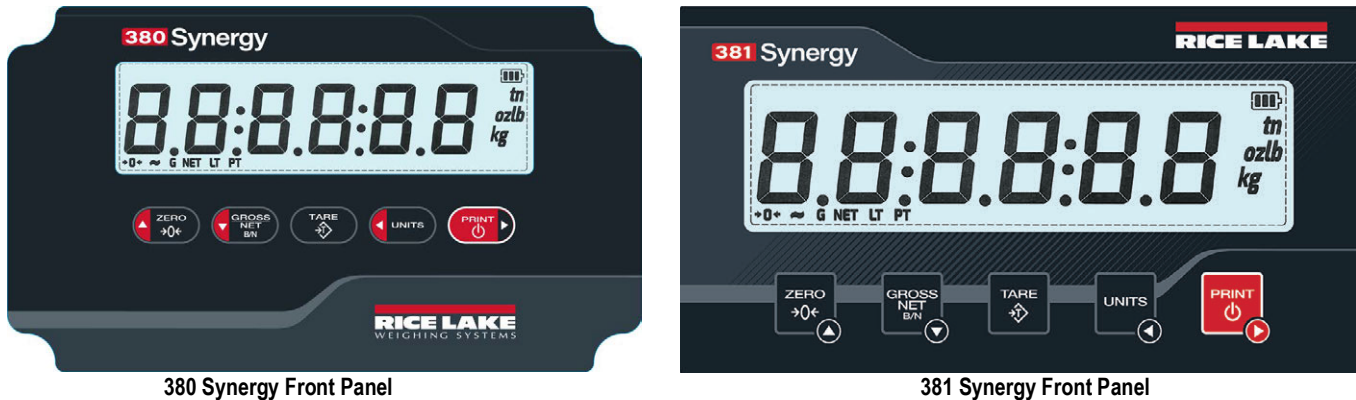


Figure 3-1. 380/381 Synergy Series Front Panels

NOTE: All procedures in this manual use the 380 keys to illustrate functions. When operating a 381 Synergy product, use the corresponding buttons below.

380 Key	381 Key	Menu Navigation	Numeric Entry	Weigh Mode Function
		Move UP menu structure	Increase digit value by 1	Sets the current gross weight to zero, provided the amount of weight to be removed or added is within the specified zero range and the scale is not in motion; the zero band is defaulted to 1.9% of full scale, but can be configured for up to 100% of full scale; hold five seconds to enter user mode when unit is already powered on IMPORTANT: Do not hold during power up. Indicator enters update firmware mode if zero is held during power up. (Section 9.5.2 on page 52)
		Move DOWN menu structure	Decrease digit value by 1	Switches the display mode from gross to net, or from net to gross; If a tare value has been entered or acquired, the net value is the gross weight minus the tare; gross mode is represented by the G annunciator; net mode is represented by the NET annunciator
		-	Confirm digit	Performs one of several predetermined Tare functions dependent on the mode of operation selected in the TARE FN parameter;
		Move LEFT in menu structure	Delete current digit and move left	Switches the weight display to an alternate unit; The alternate unit is defined in the Configuration menu, and could be kg, g, lb, oz, tn or t;
		Move RIGHT in menu structure	Move right one digit	Turns the unit ON/OFF: If ON, press and hold for five seconds to turn unit OFF If OFF, press and hold for two seconds to turn unit ON Press momentarily to send on-demand print format out the configured port, provided the conditions for standstill are met; RS 232 is default port

Table 3-1. Buttons and Descriptions

3.2 LCD Annunciators

The 380/381 display uses LCD annunciators to provide additional information about the value being displayed and battery status.



Figure 3-2. LCD Display

LCD	Description
→0←	The Center of Zero annunciator – Indicates the current gross weight reading is within ± 0.25 display divisions of the acquired zero; A display division is the resolution of the displayed weight value, or the smallest incremental increase or decrease which can be displayed or printed
G	Gross annunciator - Gross weight display mode
Net	Net annunciator – Net weight display mode
LT	Tare annunciator – Indicates a push-button tare weight has been acquired and stored in memory
PT	Preset Tare annunciator – Indicates a preset tare weight has been keyed in or entered and stored in memory
	Battery annunciator – Indicates remaining battery capacity <ul style="list-style-type: none"> • 3 bars - >95% capacity remaining • 2 bars - 5-95% capacity remaining • 1 bar - 1-5% capacity remaining • 0 bars - <1% capacity remaining
~	Unstable annunciator – Scale is unstable or outside the specified motion band; Some operations, including zero, tare and print, can only be done when the unstable annunciator is off
tn ozlb kg	Unit displayed annunciator – Displays which unit of measure is being used; units available are lb (pounds), kg (kilograms) t (tonnes), g (grams), tn (short ton), oz (ounce)

Table 3-2. LCD Annunciators

3.3 General Navigation










The front panel scale function buttons are also used to navigate through the menu structure.

- and move left and right (horizontally) in a menu level
- and move up and down to different menu levels and to exit a menu
- enters a menu or parameter and selects/saves parameter settings or values if in a value entry mode
- Press and hold for five seconds to access user mode
- Use the , , and to enter a value and press to accept the value

3.3.1 Numeric Value Entry

Several parameters in the menu structure require the entry of a numeric value rather than the making of a selection. Numbers are entered in two steps. First the numeric digits are entered, then the decimal point is positioned.

Follow this procedure to enter a numeric value:

1. Press  to enter into a parameter. The current parameter value displays. The current position in the string continuously blinks.
2. Press  and  to change location of flashing digit. Adjust digit as follows until desired number is selected.
3. Press  and  to change the flashing digit.
4. Press  to save numeric digits. Decimal position slowly flashes.
5. Press  and  to change the location of the decimal.
6. Press  to confirm the new value and exit editor. The next parameter in the menu displays.



NOTE: Pressing  also saves the new value. The next parameter in the menu displays.

NOTE: There is no decimal place to the right of the right-most digit.











3.3.2 Alphanumeric Entry

Several parameters in the menu structure require the entry of an alphanumeric value rather than the making of a selection.



NOTE: The end of the alphanumeric character string is indicated by the “_” character symbol.


Follow this procedure to enter an alphanumeric value:

1. Press  to enter into a parameter. The current parameter entry displays. The current position in the string continuously blinks.
2. Press  or  to change the blinking character to be edited.
3. Perform one of the following actions:
 - Press  to add a new character or space to the left of the blinking character
 - Press  twice to delete blinking character
 - Press  once to edit blinking character; Proceed to next step
4. Press  or  to scroll through available ASCII characters ([Table 10-4 on page 58](#)).
5. Press  to accept character edit. The next character to the right continuously blinks.
6. Repeat the previous steps until alphanumeric entry is complete.
7. Press  to confirm current string and exit editor. The next parameter in the menu displays.

3.4 Weigh Mode Operation

This section summarizes basic 380/381 operations.


3.4.1 Zero Scale



1. In gross mode, remove all weight from the scale and wait for the "~" annunciator to turn off.
2. Press . The $\rightarrow 0 \leftarrow$ displays to indicate the scale is zeroed.




NOTE: The scale must be stable and within the configured zero range for the scale to be zeroed. If the scale cannot be zeroed, see [Section 10.1 on page 53](#).

3.4.2 Print Ticket

1. Wait for the "~" annunciator to turn off.
2. Press  to send data to the configured port. The default print port is RS-232.

If the "~" annunciator is displayed when the  is pressed, the print action only occurs if the scale comes out of motion within three seconds. If the scale stays in motion for over three seconds, the  press is ignored.

3.4.3 Toggle Units


Press  to toggle between primary and secondary units. The LCD annunciator representing the current unit is displayed.

3.4.4 Toggle Gross/Net Mode




Net mode is available when a tare value has been entered or acquired (Net = Gross minus Tare). If tare has not been entered or acquired, the display remains in gross mode. The LCD annunciator G or NET indicates the current mode.

Press  to toggle the display mode between gross and net.

3.4.5 Acquire Tare




1. Place a container on the scale and wait for the "~" annunciator to turn off.
2. Press  to acquire the tare weight of the container. Then Net weight displays, and the Net and LT annunciators are displayed.

3.4.6 Remove Tare Value


1. Remove all weight from the scale and wait for the "~" annunciator to turn off. The display reads the negative tare value.
2. Press  to zero the scale, if needed.
3. Press  (or  in OIML mode). Display changes to gross weight and the Gross annunciator turns on.

3.4.7 Preset Tare (Keyed Tare)

Tare mode must be set to keyed or both for the preset tare feature to function.

1. Remove all weight from the scale and wait for the the "~" annunciator to turn off and $\rightarrow 0 \leftarrow$ annunciator to display.
2. Press and hold  for five seconds. Indicator will enter numeric entry mode.
3. Use the navigation keys to enter the tare weight value. See [Section 3.3.1 on page 26](#).
4. Press  to terminate numeric entry mode; press  a second time to terminate preset tare entry mode.
5. The display changes to net weight, the **Net** and **PT** annunciators display.









NOTE: Press  again while the "~" annunciator is off, or enter a keyed tare of zero to remove the preset tare value.

3.5 User Mode Menu

User Menu provides access to all menus in [Section 4.0 on page 30](#) except for the Setup menu. For more information on each of the menus, see the following sections:








- Audit Menu - [Section 4.3 on page 32](#)
- Accumulator Menu - [Section 4.5 on page 39](#)
- Tare Menu - [Section 4.5 on page 39](#)

3.5.1 Display a Stored Tare





1. Press  for five seconds to enter user mode. $\overline{R}Ud, t$ displays.
2. Press  or  until $tRrE$ displays.
3. Press  to enter tare menu. $dSPtRr$ displays.
4. Press  to display the stored tare value.
5. Press  four times to return to weigh mode.

If there is not a tare in the system, the value displayed is zero.







3.5.2 Clear a Stored Tare

1. Press  for five seconds to enter user mode. $\overline{R}Ud, t$ displays.
2. Press  or  until $tRrE$ displays.
3. Press  to enter tare menu. $dSPtRr$ displays.
4. Press . $tLrRr$ displays.
5. Press  to clear the stored tare value. oN displays.
6. Press  three times to return to weigh mode.








3.5.3 View Legally Relevant Version

1. Press  for five seconds to enter user mode. $\overline{R}Ud, t$ displays.
2. Press . LrU displays.
3. Press . The legally relevant version displays.
4. Press  three times to return to weigh mode.








3.5.4 Display Accumulator

1. Press  for five seconds to enter user mode. $\overline{R}Ud, t$ displays.
2. Press  or  until $RtLUN$ displays.
3. Press . $dSPRtN$ displays.
4. Press . The accumulator value displays.
5. Press  three times to return to weigh mode.

3.5.5 Print Accumulator

1. Press  for five seconds to enter user mode. RUD, t displays.
2. Press  or  until ACCUM displays.
3. Press . dSPAC displays.
4. Press . PrtACC displays.
5. Press  to print the accumulator value. dF displays.
6. Press  three times to return to weigh mode.

3.5.6 Clear Accumulator


1. Press  for five seconds to enter user mode. RUD, t displays.
2. Press  or  until ACCUM displays.
3. Press . dSPAC displays.
4. Press . CLRACC displays.
5. Press  to clear the accumulator value. dF displays.
6. Press  three times to return to weigh mode.

3.6 Reset (Default) Configuration

Perform the following to reset the indicator to factory settings:











NOTE: In order to reset the indicator to factory configured settings, the indicator must be in the Setup Menu (see [Section 4.0 on page 30](#)) and the CAL jumper must be removed (see [Section 4.1 on page 30](#)).

1. Access setup mode by pressing  once during the startup sequence. SEtUP displays.







NOTE: When accessing Setup mode, only press  once. Do not press and hold or double press .

2. Press . CONF, G displays.
3. Press . dEFFt displays.
4. Press . no displays.
5. Press . YES displays.
6. Press  to reset the configuration. dF displays.
7. Press  or . no displays.
8. Press  three times to return to weigh mode.

4.0 Configuration

There are two types of configuration parameters in the 380/381, setup mode parameters (or Legal for Trade configuration) and user mode parameters (or non-legal configuration).

- The Setup mode parameters are accessed by pressing  momentarily during the startup sequence. Only press  once. Do not press and hold or double press . All menus in this section can be accessed from within Setup mode.
- The User mode can be accessed by pressing  for five seconds. User mode includes all menus in this section other than the setup menu.



NOTE: The key press must end before start-up is complete.


NOTE: CAL jumper must be removed to access Setup mode parameters (see [Section 4.1](#)).

The following sections provide graphic representations of the 380/381 menu structures. Most menu diagrams are accompanied by a table which describes all parameters and parameter values associated with the menu. The factory default setting appears in bold type.



NOTE: All weight related parameters must be configured prior to calibrating the unit.

4.1 Seal the Indicator

Access to setup mode is typically allowed through pressing  momentarily during the power up sequence. In certain Legal for Trade applications it is necessary to restrict access to setup mode. This restriction is accomplished in two steps. First the firmware access to Setup mode must be restricted by shorting the JP3/CAL jumper on the CPU board. Then the enclosure must be secured with tamper proof seal. The 380/381 all use the same method to restrict access.



NOTE: In certain Legal for Trade applications it is necessary to seal the indicator to restrict access to the CAL jumper. Breaking of the seal terminates the Legal for Trade status of the indicator because the seal limits access to the configuration menu.

4.1.1 Close the CAL Jumper

With the jumper open, the 380/381 can be calibrated and configured. The jumper must be installed before the 380/381 is sealed for legal for trade applications. See [Figure 2-11 on page 16](#) for the location of the CAL jumper on the CPU board.



NOTE: Always place jumper onto JP3 directly aligned with the pins. If jumper is rotated or mis-aligned, the jumper will be damaged.

To restrict firmware access to the 380/381 indicator for Legal for trade applications:

1. Short the CAL jumper to restrict access to setup mode.
2. Install the cover over the CAL jumper to protect access to the jumper. (Optional)

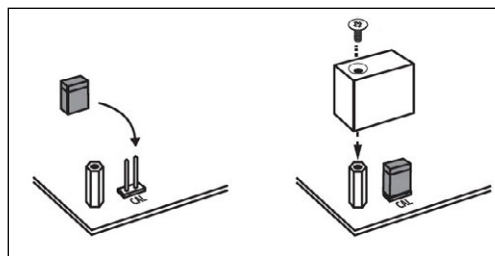


Figure 4-1. Closing the CAL Jumper

4.1.2 Seal the 380

To seal the 380 indicator to restrict access of the CAL jumper, electronics, electrical contacts and Legal for Trade configuration parameters:

1. Short the CAL jumper to restrict access to setup mode. (Figure 4-1 on page 30)
2. Torque the four front plate screws to 10 in-lb (1.1 N-m).
3. Navigate the lead sealing wire through the lower two fillister head screws on the front plate and the hole at the bottom center of the front plate, as shown in Figure 4-2.
4. Seal the wire to secure.



NOTE: CAL jumper must be in place to prevent access to Setup mode at startup (Figure 4-1 on page 30).

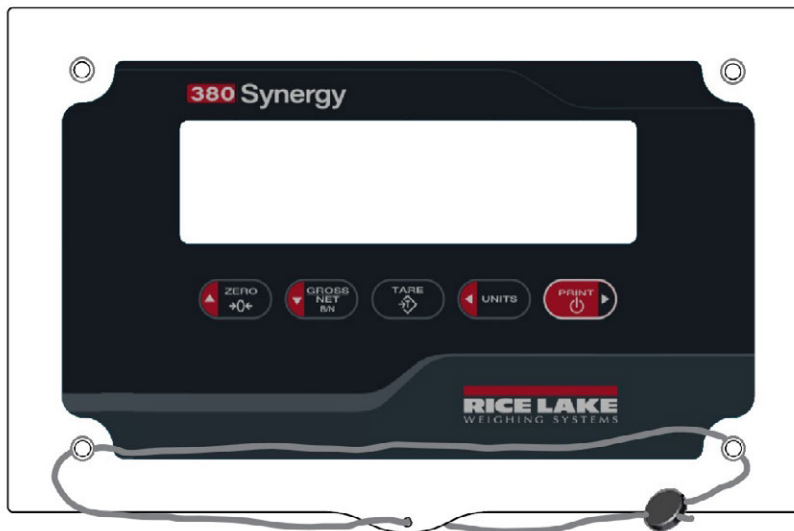


Figure 4-2. Sealing the 380 Indicator – No Access

4.1.3 Seal the 381

The 381 is sealed with a self-destructive adhesive label (PN 162882) placed over the seam between the two halves of the indicator. The seal prevents the front and back from being separated and prohibits access to the jumper .

1. Short the CAL jumper to restrict access to setup mode. (Figure 4-1 on page 30)
2. Seal 381 with two self destructive adhesive labels placed over the seam between the two halves of the indicator.

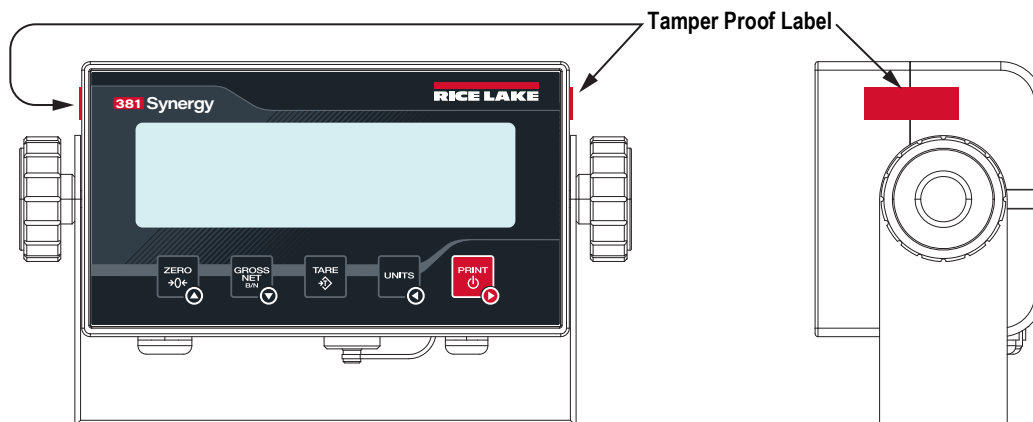


Figure 4-3. Sealing the 381 Indicator – No Access

4.2 Main Menu



Figure 4-4. Main Menu



NOTE: * Only visible in setup mode.

NOTE: ** Only visible with RTC option installed.

Parameter	Description
SEtUP	Setup – Set configuration parameters for indicator (<i>only visible in setup mode</i>); see Section 4.3
ACCUñ	Accumulator – Displays, prints and clears accumulated weight value; see Section 4.4 on page 38
tAR-E	Tare – Displays and clears stored tare value; see Section 4.5 on page 39
t,ñE	Time – Displays the time and allows the time to be edited (24-hour) (<i>Only visible with RTC option installed</i>)
dRtE	Date – Displays the date and allows the date to be edited (<i>Only visible with RTC option installed</i>)
vErS	Version – Displays the installed firmware version number
Rudít	Audit – Displays the legally relevant firmware version number; see Section 4.6 on page 39

Table 4-1. Main Menu Descriptions

4.3 Setup Menu

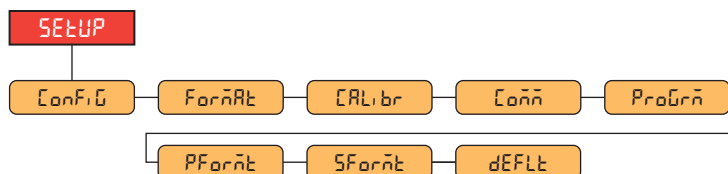


Figure 4-5. Setup Menu



NOTE: Setup menu is only visible in setup mode.

Parameter	Description
ConF, G	Configuration – See Section 4.3.1 on page 33 for menu structure and parameter descriptions of the Configuration menu
ForñRt	Format – See Section 4.3.2 on page 34 for menu structure and parameter descriptions of the Format menu
CRLi, br	Calibration – See Section 4.3.3 on page 34 for menu structure and parameter descriptions of the Calibration menu
Coññ	Communication – See Section 4.3.4 on page 35 for menu structure and parameter descriptions of the Communication menu
ProGurñ	Program – See Section 4.3.5 on page 36 for menu structure and parameter descriptions of the Program menu
PFoññt	Print Format – See Section 4.3.6 on page 37 for menu structure and parameter descriptions of the Print Format menu
SFoññt	Stream Format – See Section 4.3.7 on page 38 for menu structure and parameter descriptions of the Stream Format menu
dEFLt	Default Configuration – Resets settings to indicator default

Table 4-2. Setup Menu Descriptions

4.3.1 Setup – Configuration Menu

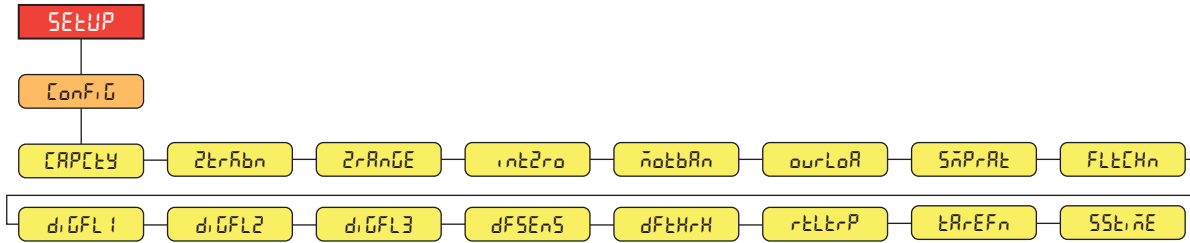


Figure 4-6. Setup – Configuration Menu

Parameter	Description
CAPCY	Capacity – Maximum rated capacity of the scale; <i>Enter value: 0.000001–99999.0, 10000.0 (default)</i>
ZTRBND	Zero Track Band – Automatically zeros the scale when within the range specified, as long as the input is within the ZRNGE and scale standstill; Max legal value depends on local regulations; Specify the zero tracking band in ± display divisions; <i>Enter value: 0.0–100.0, 0.0 (default)</i>
ZRNGE	Zero Range – The total amount the scale can be zeroed; Zero range represents a percentage of capacity; The default value of 1.9 represents ±1.9% around the calibrated zero point, for a total range of 3.8%; A value of 0.0 prevents zeroing; Maximum legal value depends on local regulations; <i>Enter value: 0.0–100.0, 1.9 (default)</i>
INTRNG	Initial Zero Range – When the indicator is turned on and the weight value is between the ± percent range specified of Calibrated Zero, the indicator automatically zeros off the weight; <i>Enter value: 0.0–100.0, 0.0 (default)</i>
MOTBND	Motion Band – Sets the level, in display divisions, at which scale motion is detected; If motion is not detected for the time defined by STSNTM, the motion annunciator is not displayed; Some operations, including print, tare, and zero, require the scale to be at standstill; Maximum legal value varies depending on local regulations; If this parameter is set to 0, the motion annunciator is never lit and operations requiring standstill are performed regardless of scale motion; If 0 is selected, ZTRBND must also be set to 0; <i>Enter value: 0–100, 1 (default)</i>
OVLDR	Overload – Determines the point at which the display blanks and the overload error message displays (^^^^); Maximum legal value varies depending on local regulations; <i>Settings: FS+2% (default), FS+1D, FS+9D, FS</i>
SNPRRT	Sample Rate – Selects measurement rate, in samples per second, of the analog-to-digital converter; Lower sample rate values provide greater signal noise immunity; <i>Settings: 5HZ, 6HZ, 10HZ, 12HZ, 20HZ, 25HZ (Default), 40HZ, 50HZ, 80HZ, 100HZ</i>
FLTCHN	Filter Chain Type – Sets the filter type to be used; <i>Settings:</i> AVGONLY (default) – Digital Rolling Average Filter (Section 10.5.1 on page 56); Uses DIGFL1-3, DFSENS and DFTHRSH RAW – No filtering
DIGFL1-3	Digital Filters – Sets the digital filtering rate used to reduce the effects of environmental influences from the immediate area of the scale; Settings indicate the number of A/D conversions per update which are averaged to obtain the displayed reading; a higher number gives a more accurate display by minimizing the effect of a few noisy readings, but slows down the response time of the indicator; <i>Settings: 1, 2, 4 (default), 8, 16, 32, 64, 128, 256</i>
DFSENS	Digital Filter Sensitivity – Specifies the number of consecutive A/D readings which fall outside the Filter Threshold before filtering is suspended; <i>Settings: 2OUT (default), 4OUT, 8OUT, 16OUT, 32OUT, 64OUT, 128OUT</i>
DFTHRSH	Digital Filter Threshold – Sets a threshold value, in display divisions; when a number of consecutive A/D readings (Digital Filter Sensitivity) falls outside of this threshold value (when compared to the output of the filter), filtering is suspended and the A/D value is sent straight through the filter; Filtering is not suspended if the threshold is set to NONE; <i>Settings: NONE (default), 2D, 5D, 10D, 20D, 50D, 100D, 200D, 250D</i>
RATTLEP	RattleTrap – Enables RattleTrap filtering; Effective at eliminating vibration effects, environmental influences and mechanical interference from nearby machinery, may increase response time over standard digital filtering; <i>Settings: OFF (default), ON</i>
TAREFN	Tare Function – Enables or disables push-button and keyed tare; <i>Settings:</i> BOTH (default) – Both push-button and keyed tare are enabled NOTARE – No tare allowed (gross mode only) PBTARE – Push-button tares enabled KEYED – Keyed tare enabled
STSNTM	Standstill Time – Specifies the length of time the scale must be out of motion, before the scale is considered to be at standstill (in 0.1 sec intervals); <i>Enter value: 0–600, 10 (default)</i>

Table 4-3. Setup – Configuration Menu Descriptions

4.3.2 Setup – Format Menu

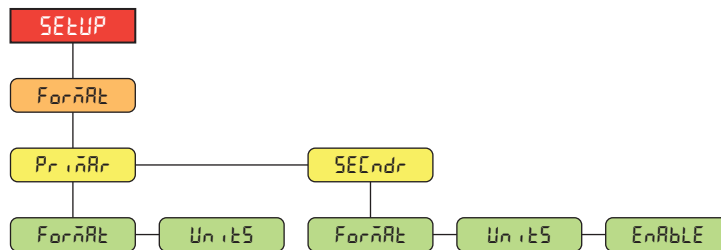


Figure 4-7. Format – Primary and Secondary Menus

Parameter	Description
Format	Format – Sets the decimal point and the display divisions for the Primary (Primary) and Secondary (Secondary) display weight format; For example, select 888.885 if a count by of 0.005 is needed or select 888820 if a count by of 20 is needed (the 8s serve as placeholders and show a breakdown of how digits will display); Settings: 888881 (Primary default), 888882, 888885, 888810, 888820, 888850, 888100, 888200, 888500, 8.88881, 8.88882, 8.88885, 88.8881, 88.8882, 88.8885, 888.881, 888.882, 888.885, 8888.81, 8888.82, 8888.85, 88888.1, 88888.2, 88888.5 (Secondary default)
Units	Units – Sets the units type; Settings: LB (Primary default), KG (Secondary default), OZ, TN, T, G, NONE
ENABLE	Enabled – Enables UNITS button to toggle between the primary and secondary units; Settings: ON (default), OFF

Table 4-4. Format – Primary and Secondary Menu Description

4.3.3 Setup – Calibration Menu

For more information on Calibration procedures, see [Section 5.0 on page 40](#).

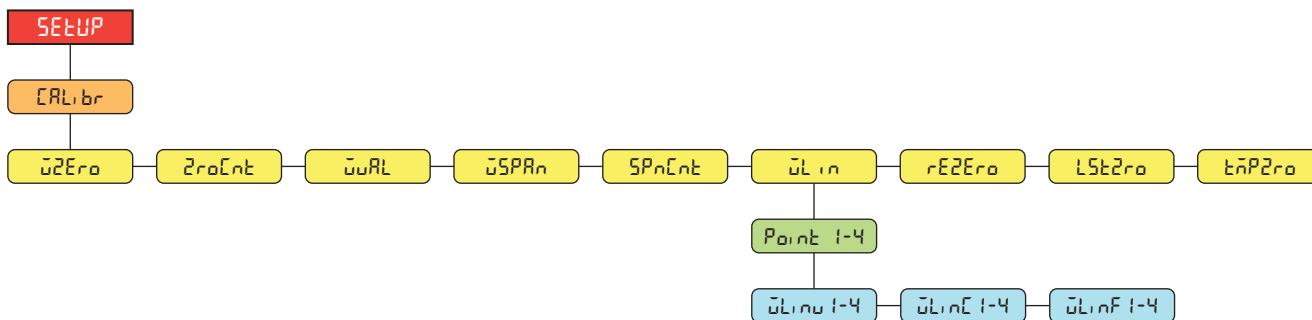


Figure 4-8. Setup – Calibration Menu

Parameter	Description
WZERO	Zero Calibration – Executes the zero calibration process;
ZroCnt	Zero Calibration Count – Displays the raw count value at the zero weight; A zero calibration (WZERO) generates this raw count value; Manually changing this count value changes the zero weight and negates the zero calibration
WuRL	Test Weight Value – Sets the weight value for the span calibration; Enter value: 0.000001–999999.999999, 10000.0 (default)
WSPRn	Span Calibration – Executes the span calibration process;
SPnCnt	Span Calibration Count – Displays the raw count value at the span weight; A span calibration (WSPAN) generates this raw count value; Manually changing this count value changes the span weight and negates the span calibration

Table 4-5. Setup – Calibration Menu Description

Parameter	Description
WLIN	Linear Calibration – A linear or multi-point calibration is performed by entering up to four additional calibration points; WLIN V# – Sets the test weight value for linear calibration point WLIN C# – Executes the linear calibration process for the point; generates the raw count value (F) for the test weight value (V) WLIN F# – Displays the raw count value at the linear point weight; A linear calibration (WLIN C#) generates this raw count value; Manually changing this count value changes the linear point weight and negates the linear calibration for the point
rZERo	Rezero – Removes an offset value from the zero and span calibrations
LSZERo	Last Zero – Takes the last pushbutton zero in the system (from weigh mode) and uses it as the new zero reference point, after which a new span calibration must be performed; This calibration cannot be performed when calibrating a scale for the first time
tñPZro	Temporary Zero – Temporarily zeros the displayed weight of a non-empty scale, after a span calibration was performed; The difference between the temporary zero and the previously calibrated zero value is used as an offset

Table 4-5. Setup – Calibration Menu Description (Continued)

4.3.4 Setup – Communication Menu

Serial Port supports RS-232 serial communication. USB port Supports USB Virtual communication port.

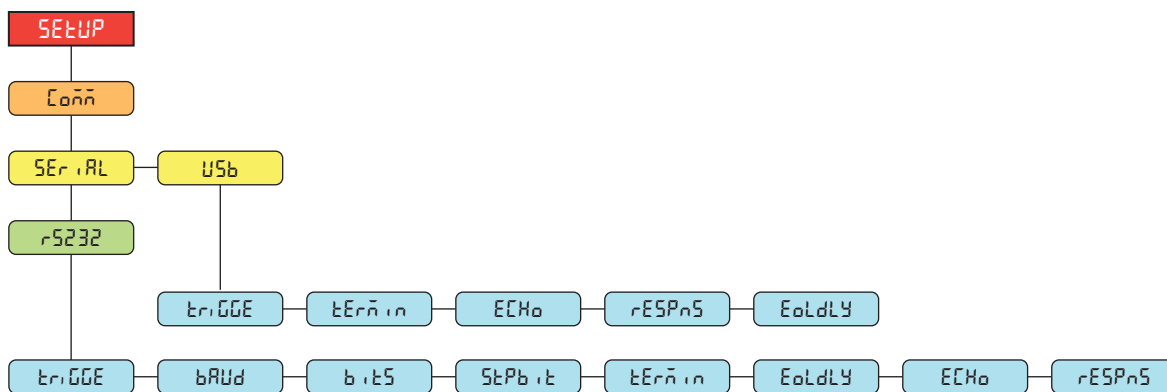


Figure 4-9. Communication – Serial Port Menu

Parameter	Description
tRIGGE	Trigger – Sets the input trigger type; Settings: CMD (default) – Command: allows operation of EDP commands and printing STRIND – Stream Industrial Scale Data: data is updated up to the configured sample rate; allows operation of EDP commands and printing STRLFT – Stream Legal for Trade Data: data is updated at the configured display update rate; allows operation of EDP commands and printing
bRud	Baud Rate – Sets the transmission speed for the port (RS-232 only); Settings: 1200, 2400, 4800, 9600 (default), 19200, 38400, 57600, 115200
b,tS	Data Bits – Sets number of data bits transmitted or received by the port and specifies the parity bit to odd, even or none (RS-232 only); Settings: 8NONE (default), 7EVEN, 7ODD
StPb,t	Stop Bits – Sets the number of stop bits transmitted or received by the port (RS-232 only); Settings: 1 (default), 2
tErñin	Outgoing Line Termination – Sets the termination characters for data sent from the port; Settings: CR/LF (default), CR
EoLdLY	End of Line Delay – Sets the delay period from when a formatted line is terminated to the beginning of the next formatted serial output (measured in 0.1 second intervals); Enter value: 0–255, 0 (default)
ECHO	Echo – Specifies if characters received by the port are echoed back to the sending unit; Settings: ON (default), OFF
rESPnS	Response – Specifies if the port transmits replies to serial commands; Settings: ON (default), OFF

Table 4-6. Communication – Serial Port Menu Description

4.3.5 Setup – Program Menu

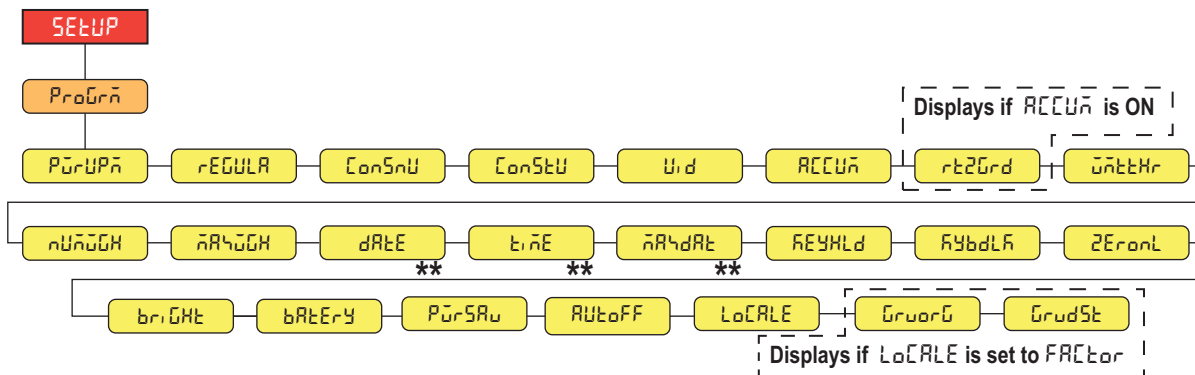


Figure 4-10. Setup – Program Menu

NOTE: ** Only visible with RTC option installed.

Parameter	Description
PūrUPā	Power Up Mode – When the indicator is turned on, it performs a display test, then enters a warm up period; <i>Settings:</i> GO (default) – Performs display test, then enters weigh mode after brief warm up period DELAY – Performs display test, then enters a warm up period of 30 seconds <ul style="list-style-type: none"> • If no motion is detected during warm up period, indicator enters weigh mode when warm up period ends • If motion is detected, the 30 second timer is reset and the warm up period is repeated
rEGULR	Regulatory Mode – Specifies the regulatory agency having jurisdiction over the scale site; the value specified for this parameter affects the function of the front panel tare and zero keys; <i>Settings:</i> NTEP (default) , OIML, CANADA, NONE <ul style="list-style-type: none"> • OIML, NTEP, and CANADA modes allow a tare to be acquired at a weight greater than zero; NONE allows tares to be acquired at any weight value • OIML, NTEP, and CANADA modes allow a tare to be cleared only if the gross weight is at no load; NONE allows tares to be cleared at any weight value • NTEP and OIML modes allow a new tare to be acquired even if a tare is already present; In CANADA mode, the previous tare must be cleared before a new tare can be acquired • NONE, NTEP and CANADA modes allow the scale to be zeroed in either gross or net mode as long as the current weight is within the specified ZRANGE; In OIML mode, the scale must be in gross mode before it can be zeroed; pressing the ZERO key in net mode clears the tare
ĆonSnu	Consecutive Numbering – Allows sequential numbering for print operations; the value is incremented following each print operation which includes <CN> in the ticket format; <i>Enter value:</i> 0–999999, 0 (default)
ĆonStU	Consecutive Number Startup Value – Specifies the initial consecutive number (CONSNU) value used when the consecutive number is reset by sending KCLRCN EDP serial command; <i>Enter value:</i> 0–999999, 0 (default)
U,d	Unit ID – Specifies the unit identification string with an alphanumeric value; <i>Enter characters:</i> Up to 8 alphanumeric characters, 1 (default)
ACCUā	Accumulator – Accumulation can be toggled ON/OFF; if ON, accumulation occurs on print operation; if OFF, an accumulation does not occur; <i>Settings:</i> OFF (default) , ON
rēZGrd	Return to Zero Grads – When the weight (in display graduations) falls below the value set, the accumulator is rearmed; <i>Enter Value:</i> 0.0–100.0, 0.4 (default)
ūnētHr	Weightment Threshold – When the weight exceeds the value set, the number of weightments counter is incremented; <i>Enter value:</i> 0.0–999999.0, 1000.0 (default)
nūāGā	Number of Weightments – Displays the total number of weightments; <i>Read only</i>
āRāGā	Maximum Weightment – Displays the maximum weightment made; <i>Read only</i>
āRādRt	Date/Time of Max Weight – Displays the date the maximum weightment occurred; <i>Read only (only available when RTC is installed)</i>
dRtE	Date – Allows setting of the date format and date separator character; <i>(only available when RTC is installed)</i> DATEFMT – Date Format; <i>Settings:</i> MMDDYY (default) , DDMMYY, YYMMDD, YYDDMM DATESEP – Date Separator; <i>Settings:</i> SLASH (default) , DASH, SEMI, DOT

Table 4-7. Setup – Program Menu Description

Parameter	Description
ᵀᵀᵀᵀ	Time – Allows setting of the time format and the separator character; <i>(only available when RTC is installed)</i> TIMEFMT – Time Format; Settings: 12HOUR (default), 24HOUR TIMESEP – Time Separator; Settings: COLON (default), COMMA, DOT
ᵀᵀᵀᵀᵀ	Key Hold – Allows setting of the key hold time and interval HLDTIME – Key hold time (in tenths of a second); 20 equals 2 seconds; <i>Enter value: 10–50, 20 (default)</i> INTRVL – Key hold time interval; the amount of time between increments during a key hold (in twentieths of a second); 2 equals a tenth of a second (10 increments per second during a key hold); <i>Enter value: 1–100, 2 (default)</i>
ᵀᵀᵀᵀᵀ	Keyboard Lock – Disables the keyboard except power; settings: OFF (Default), ON
ᵀᵀᵀᵀᵀᵀ	Zero Only – Disables the keyboard except Zero and Power; settings: OFF (Default), ON
ᵀᵀᵀᵀᵀᵀ	Brightness of Back Light; settings: LOW (default), MED, HIGH, OFF
ᵀᵀᵀᵀᵀᵀ	Battery – Power supply via battery NONE – No battery ALK – Alkaline battery (non-rechargeable) NIMH – Nicken Metal Hydrade LITHIM – Lithium Ion
ᵀᵀᵀᵀᵀᵀ	Power Saving mode – Energy saving for battery operation NONE (default) LOW – Turns off backlight after 30 seconds of no activity; changing weight or a button press will illuminate the backlight HIGH – Turns off backlight and load cell after 30 seconds at zero weight; any button must be pressed to wake up indicator
ᵀᵀᵀᵀᵀᵀᵀ	Auto Off Time – Time (in minutes) at zero weight after which the scale will power off. A setting of 0 will not power off; Settings: 0 (default) - 60
ᵀᵀᵀᵀᵀᵀᵀ	Location Gravity Compensation – Enables gravity compensation; Settings: OFF (default) – gravity compensation disabled FACTOR – uses origin and destination gravity factors to find gravity compensation
ᵀᵀᵀᵀᵀᵀᵀ	Gravity of Origin – Original gravity factor (in m/s ²) for gravity compensation; displays when LOCALE parameter is set to FACTOR; <i>Enter value: 9.00000–9.99999, 9.80665 (default)</i>
ᵀᵀᵀᵀᵀᵀᵀᵀ	Gravity of Destination – Destination gravity factor (in m/s ²) for gravity compensation; displays when LOCALE parameter is set to FACTOR; <i>Enter value: 9.00000–9.99999, 9.80665 (default)</i>

Table 4-7. Setup – Program Menu Description (Continued)

4.3.6 Setup – Print Format Menu

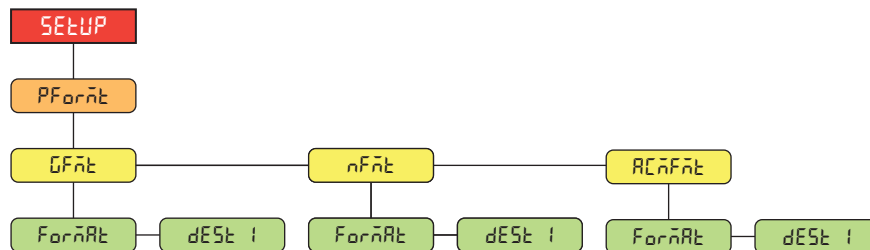


Figure 4-11. Setup – Print Format Menu

Parameter	Description
ᵀᵀᵀᵀᵀ	Gross Format – Gross demand print format string FORMAT – <i>Enter characters: Alphanumeric entry up to 300 characters, Gross<g><n12> (default)</i> DEST 1 – Destination ports; Settings: RS232 , USB, NONE
nᵀᵀᵀᵀᵀ	Net Format – Net demand print format string FORMAT – <i>Enter characters: Alphanumeric entry up to 300 characters, Gross<g><n1>Tare<sp><t><n1>Net<sp2><n><n12> (default)</i> DEST 1 – Destination ports; Settings: RS232 , USB, NONE

Table 4-8. Setup – Print Format Menu Description

Parameter	Description
RFnŁ	Accumulator Format – Accumulator print format string FORMAT – Enter characters: Alphanumeric entry up to 300 characters, Accum <a><n!> (default) DEST 1 – Destination ports; Settings: RS232, USB, NONE

Table 4-8. Setup – Print Format Menu Description

4.3.7 Setup – Stream Format Menu

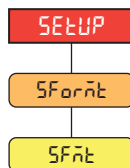


Figure 4-12. Setup – Stream Format Menu

Parameter	Description
SFnŁ	Stream Format – Specifies the stream format used for streaming output of scale data; Settings: RLWS (default) – Rice Lake Weighing Systems stream format; see Section 10.3.1 on page 54 CRDNAL – Cardinal stream format; see Section 10.3.2 on page 54 WTRNIX – Avery Weigh-Tronix stream format; see Section 10.3.3 on page 55 TOLEDO – Mettler Toledo stream format; see Section 10.3.4 on page 55

Table 4-9. Setup – Stream Format Menu Description

4.4 Accumulator Menu



Figure 4-13. Accumulator Menu

Parameter	Description
dSPRnŁ	Display Accumulator – Displays the accumulator value; Read Only
PrŁRnŁ	Print Accumulator – Prints the accumulator value to specified port, if setup
ŁŁRnŁ	Clear Accumulator – Clears the accumulator value

Table 4-10. Accumulator Menu Description

4.5 Tare Menu




Figure 4-14. Tare Menu

Parameter	Description
dSPtAr	Display Tare – Displays the current tare value; <i>Read Only</i>
CLrAr	Clear Tare – Clears the current tare value

Table 4-11. Tare Menu Description

4.6 Audit Menu



Figure 4-15. Audit Menu

Parameter	Description
LRV	LRV – Legally relevant firmware version

Table 4-12. Audit Menu Description

5.0 Calibration

The 380/381 can be calibrated using the front panel or EDP commands. The following sections describe the procedures required for these calibration methods.

NOTE: CAL jumper must be removed to perform calibration.

NOTE: The 380/381 requires a WZERO and WSPAN points to be calibrated. The linear calibration points are optional; they must fall between zero and span, but must not duplicate zero or span.

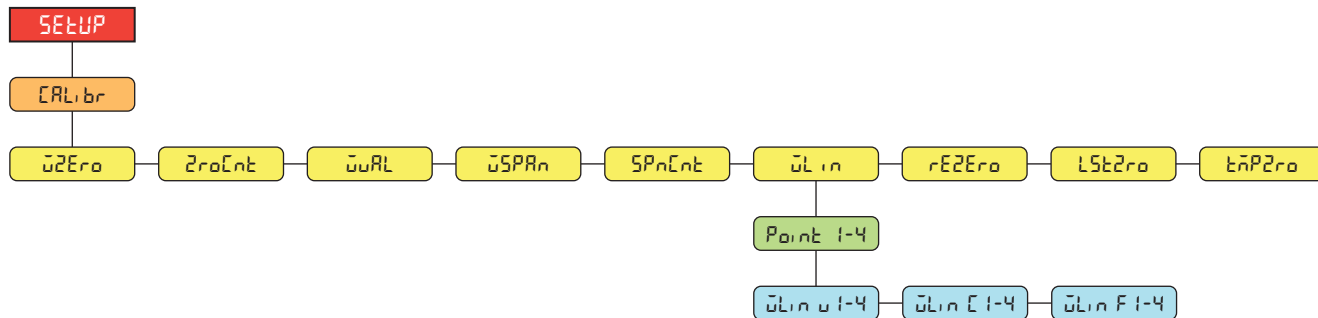


Figure 5-1. Calibration Menu

5.1 Front Panel Calibration

5.1.1 Span Calibration

Use the following steps to perform a standard span calibration on a connected scale.

1. Access the setup menu by pressing momentarily during power up. SETUP displays.

NOTE: When accessing Setup mode, only press once. Do not press and hold or double press .

NOTE: CAL jumper must be removed to perform calibration (see [Section 4.1 on page 30](#)).

2. Press once. CONF displays.
3. Press twice. CALibr displays.
4. Press . WZERO displays.

NOTE: See [Section 5.2 on page 41](#) if the application requires a rezero, last zero or temporary zero.










5. Ensure there is no weight on the scale.
6. Press to perform a zero calibration. 0F displays.
7. Press . ZroCnE displays. See [Section 4.3.3 on page 34](#) for more information on ZroCnE.
8. Press . WuRL displays.
9. Press . The current test weight value displays.
10. Enter a new value, if necessary. See [Section 3.3.1 on page 26](#) for more information on numeric entry.
11. Press to accept value. WSPRn displays.
12. Place the specified amount of test weight on the scale.
13. Press to perform a span calibration. 0F displays.
14. Press . SPnCnE displays. See [Section 4.3.3 on page 34](#) for more information on SPnCnE.

NOTE: Span calibration is complete. To continue with a linear calibration, proceed to [Section 5.1.2 on page 41](#).

15. Press three times to return to weigh mode.

5.1.2 Linear Calibration

Linear calibration points provide increased scale accuracy by calibrating the indicator at up to four additional points between the zero and span calibrations.

1. Complete [steps 1–14 in Section 5.1.1 on page 40](#).
2. Press . $\bar{W}LIN$ displays.
3. Press . $P0.0000$ displays.
4. Press . $\bar{W}LIN 01$ displays.
5. Press . The current test weight value for point 1 displays.
6. Enter a new value, if necessary. See [Section 3.3.1 on page 26](#) for more information on numeric entry.
7. Press  to accept value. $\bar{W}LIN 01$ displays.
8. Place the specified amount of test weight on the scale.
9. Press  to perform a linear point calibration. OK displays.
10. Press . $\bar{W}LIN F1$ displays. See [Section 4.3.3 on page 34](#) for more information on $WLIN F\#$.
11. Press . $P0.0000$ displays.
12. Press . $P0.0002$ displays.
13. Repeat previous steps for points 2-4, if necessary.



NOTE: *The linear calibration for a point is saved once point is calibrated.*

14. Press  three times to return to weigh mode.

5.2 Alternative Zero Calibrations

During a calibration, the zero value ($\bar{Z}ER0$) can be replaced with a temporary zero ($\bar{T}EMPZ0$) or last zero ($\bar{L}ASTZ0$). A rezero ($\bar{R}EZ0$) can be done after calibration. See below for information on these alternative zeros.

5.2.1 Last Zero

This takes the last push-button zero in the system (from weigh mode) and uses it as the new zero reference point, after which a new span calibration must be performed. This calibration cannot be performed when calibrating a scale for the first time.

A last zero calibration is typically used on truck scales to allow a scale verification to become a calibration without having to remove the test weights.

5.2.2 Temporary Zero

A temporary zero calibration temporarily zeros the displayed weight of a non-empty scale. After span calibration, the difference between the temporary zero and the previously calibrated zero value is used as an offset.

A temporary zero calibration is typically used on hopper scales to calibrate the span without losing the original zero calibration.

5.2.3 Rezero

A rezero calibration is needed to remove a calibration offset when hooks or chains are required to suspend the test weights.

Once a span calibration is complete, remove the hooks or chains and the test weights from the scale. With all the weight removed, a rezero calibration is used to adjust the zero and span calibration values.

5.3 EDP Command Calibration

Use the following instructions to calibrate the 380/381 using EDP commands. For information on the EDP commands of the 380/381, see [Section 7.0 on page 44](#).



NOTE: *The indicator must respond with OK after each step or the calibration procedure must be done again.*

For commands ending with #s, s is the scale number (1).

1. Enter setup mode ([Section 4.1 on page 30](#)).



NOTE: *CAL jumper must be removed to perform calibration.*

2. For a standard calibration, remove all weight from scale (except hooks or chains which are needed to attach weights).
3. Send the command **SC.WZERO#s** to perform a standard calibration of the zero point.
 - Send **SC.TEMPZERO#s** to perform a temporary zero calibration
 - Send **SC.LASTZERO#s** to perform a last zero calibration
4. Apply the span calibration weight to the scale.
5. Send the command **SC.WVAL#s=xxxxx**, where **xxxxx** is the value of the span calibration weight applied to the scale.
6. Send the command **SC.WSPAN#s** to calibrate the span point. Continue on to [step 7](#) to calibrate additional linearization points, or proceed to [step 11](#).
7. Apply weight equal to the first linearization point to the scale.
8. Send the command **SC.WLIN.Vn#s=xxxxx**, where **n** is the linearization point number (1-4) and **xxxxx** is the exact value of the weight applied.
9. Send the command **SC.WLIN.Cn#s** to calibrate the linearization point, where **n** is the linearization point number (1-4).
10. Repeat [steps 7–9](#) for up to four total linearization points.
11. If hooks or chains were used to attach the weights, remove all weight, including the hooks and chains, and send the command **SC.REZERO#s** to remove the zero offset.
12. Send the command **KSAVEEXIT** to return to weigh mode.

6.0 Revolution

The Revolution utility provides a suite of functions used to support configuration, calibration, customization, backing up configuration settings and updating firmware.

Calibration values and scale configuration can both be saved from and restored to the 380/381 using Revolution.



NOTE: For system requirements visit the Revolution product page on [Rice Lake Weighing Systems website](#).

6.1 Connecting to the Indicator

Connect the PC serial port to com 1 of the 380/381, then click **Connect** in the toolbar. Revolution attempts to establish communications to the indicator. If communications settings need to be adjusted, select **Options...** from the Tools menu.

Downloading to the Indicator

The **Send Configuration to Device** function in the Revolution Communications menu allows a Revolution configuration file (with or without scale calibration data) or ticket formats to be downloaded to a connected indicator in setup mode.

The **Send Section to Device** function on the Communications menu allows the download of only the currently displayed object, such as a scale configuration.

Because less data is transferred using the **Send Section to Device**, it is typically faster than a full configuration download, but there is an increased possibility the download fails due to dependencies on other objects. If the download fails, try performing a complete download using the **Send Configuration to Device** function.

Uploading Configuration to Revolution

The **Get Configuration from Device** function in the Revolution Communications menu allows the existing configuration of a connected indicator to be saved to a file on the PC. Once saved, the configuration file provides a backup which can be quickly restored to the indicator if needed. Alternatively, the file can be edited within Revolution and downloaded back to the indicator.

6.2 Saving and Transferring Data



NOTE: Revolution has a module to save and transfer data. It is the preferred method over using ProComm or Hyper Terminal.

6.2.1 Saving Indicator Data to a Personal Computer

Configuration data can be saved to a computer connected to the selected port. The PC must be running a terminal emulator such as *Tera Term* or *PuTTY*.

When configuring the indicator, ensure the values set for the baud and bits parameters on the serial menu match the baud rate, bits and parity settings configured for the serial port on the PC.

To save all configuration data, first put the terminal emulator into data capture mode, then place the indicator in setup mode and send the DUMPALL command to the indicator. The 380/381 responds by sending all configuration parameters to the PC as ASCII-formatted text.

6.2.2 Downloading Configuration Data from PC to Indicator

Configuration data saved on a PC or disc can be downloaded from the PC to an indicator. This procedure is useful when a number of indicators with similar configurations are set up or when an indicator is replaced.

To Send Configuration to the Device, connect the PC to the selected port as described in [Section 6.2.1](#). Place the indicator in setup mode and use the PC communications software to send the saved configuration data to the indicator. When transfer is complete, calibrate the indicator as described in [Section 5.0 on page 40](#).

7.0 EDP Commands

The 380/381 indicator can be controlled by a personal computer connected to one of the indicator communication ports. Control is provided by a set of commands which can simulate front panel key press functions, return and change setup parameters, and perform reporting functions. The commands provide the capability to print configuration data or to save data to an attached personal computer. This section describes the EDP command set and procedures for saving and transferring data using the communication ports. The EDP command set is divided into several groups.

When the indicator processes a command, it either responds with a value (for reporting commands, or when querying parameter settings), or with the message **OK**. The **OK** response verifies the command was received. If the command is unrecognized, the indicator responds with **?? invalid command**. If the command cannot be executed in the current mode, the indicator responds with **?? invalid mode**. If the command is recognized, but the value is out of range or the invalid type, the indicator responds with **??** followed by the type and the range.

7.1 Key Press Commands

Key press serial commands simulate pressing keys on the front panel of the indicator. These commands can be used in both setup and weigh mode. Several of the commands serve as pseudo keys, providing functions which are not represented by a key on the front panel.

For example, to enter a 15 lb tare weight using serial commands:

1. Type **K1** and press **Enter** (or **Return**).
2. Type **K5** and press **Enter**.
3. Type **KTARE** and press **Enter**.

Command	Function
KZERO	In weigh mode, this command acts like pressing the Zero key
KGROSSNET	In weigh mode, this command acts like pressing the Gross/Net key
KGROSS	Displays Gross mode (pseudo key)
KNET	Displays Net mode (pseudo key)
KTARE	In weigh mode, this command acts like pressing the Tare key
KUNITS	In weigh mode, this command acts like pressing the Units key
KPRIM	Displays primary units (pseudo key)
KSEC	Displays secondary units (pseudo key)
KPRINT	In weigh mode, this command acts like pressing the Print key
KPRINTACCUM	Prints the accumulated weight (pseudo key)
KDISPACCUM	Displays the accumulator value (pseudo key)
KDISPTARE	Displays the tare value (pseudo key)
KCLR	Clears number (pseudo key)
KCLRCN	Clears consecutive number (pseudo key)
KCLRTAR	Clears the tare from the system (pseudo key)
KLEFT	In setup mode, this command moves Left in the menu
KRIGHT	In setup mode, this command moves Right in the menu
KUP	In setup mode, this command moves Up in the menu
KDOWN	In setup mode, this command moves Down in the menu
KEXIT	In setup mode, this command exits to weigh mode (pseudo key)
KSAVE	In setup mode, save the current configuration (pseudo key)
KSAVEEXIT	In setup mode, save the current configuration then exit to normal mode (pseudo key)
KCLRACCUM	Clears the accumulator (pseudo key)
Kn	This command acts like pressing numbers 0 (zero) through 9 (pseudo key)
KDOT	This command acts like pressing the decimal point (.) (pseudo key)
KENTER	This command acts like pressing the Enter key (pseudo key)
KLOCK=x	In setup mode, this command locks specified front panel key; x = KPRINT, KUNITS, KTARE, KGROSSNET, KZERO (example: to lock the Zero key, enter KLOCK=KZERO)
KUNLOCK=x	In setup mode, this command unlocks specified front panel key; x = KPRINT, KUNITS, KTARE, KGROSSNET, KZERO (example: to unlock the Print key, enter KUNLOCK=KPRINT)

Table 7-1. Key Press Commands

7.2 Reporting Commands

Reporting commands return specific information to the communications port. The commands listed in Table 7-2 can be used in either setup mode or weigh mode.

Command	Function
DUMPALL	Returns a list of all parameter values
AUDIT.LRVERSION	Returns the legally relevant firmware version
VERSION	Returns the firmware version
BUILD	Returns the firmware version and build number
HWSUPPORT	Returns the CPU board part number
HARDWARE	Returns C1 if the RTC Option is installed, or FF if no option is installed

Table 7-2. Reporting Commands

7.3 Reset Configuration Command

The following command can be used to reset the configuration parameters of the 380/381.

Command	Function
RESETCONFIGURATION	Restores all configuration parameters to default values (setup mode only)

Table 7-3. Reset Configuration Command



NOTE: All scale calibration settings are lost when the **RESETCONFIGURATION** command is run.

7.4 Parameter Setting Commands

Parameter setting commands allow the current value for a configuration parameter to be displayed or changed.

Current configuration parameter settings can be displayed in setup mode or weigh mode using the following syntax:

command<ENTER>

Most parameter values can be changed in setup mode only.

Use the following command syntax when changing parameter values: command=value<ENTER>. Use no spaces before or after the equal (=) sign. If an incorrect command is typed or an invalid value is specified, the indicator returns ?? followed by the error message.

Example: to set the motion band parameter on Scale #1 to 5 divisions, type the following:

SC.MOTBAND#1=5<ENTER>

To return a list of the available values for parameters, enter the command and equal sign, followed by a question mark (command=?<ENTER>). The indicator must be in setup mode to use this function.

After changes are made to configuration parameters using EDP commands, use the **KSAVE** or **KSAVEEXIT** commands to commit the changes to memory.

Command	Description	Values
SC.CAPACITY#n	Scale capacity	0.000001–999999.0, 10000.0 (default)
SC.ZTRKBND#n	Zero track band (in display divisions)	0.0–100.0, 0.0 (default)
SC.ZRANGE#n	Zero range in % of Full Scale (capacity)	0.0–100.0, 1.9 (default)
SC.INITIALZERO#n	Initial Zero range in % of full scale	0.0–100.0, 0.0 (default)
SC.MOTBAND#n	Motion band (in display divisions)	0–100, 1 (default)
SC.SSTIME#n	Standstill time (in 0.1 second intervals; 10 = 1 second)	0–600, 10 (default)
SC.OVERLOAD#n	Overload	FS+2% (default), FS+1D, FS+9D, FS
SC.MAX_WEIGHT#n	Maximum weightment (read only)	-999999–999999
SC.NUMWEIGH#n	Number of weighments (read only)	0–4294967295
For commands ending with #n, n is the scale number (1)		

Table 7-4. Scales Commands

Command	Description	Values
SC.MAX_DATE#n	Date of maximum weightment (read only)	Up to 25 alphanumeric characters (Only available if RTC option is installed)
SC.WMTTHR#n	Weightment threshold	0.0–999999.0, 1000.0 (default)
SC.DIGFLTR1#n SC.DIGFLTR2#n SC.DIGFLTR3#n	Number of A/D samples averaged for the individual stages (1-3) of the three stage digital filter	1, 2, 4 (default), 8, 16, 32, 64, 128, 256
SC.DFSENS#n	Digital filter cutout sensitivity	2OUT (default), 4OUT, 8OUT, 16OUT, 32OUT, 64OUT, 128OUT
SC.DFTHR#n	Digital filter cutout threshold	NONE (default), 2D, 5D, 10D, 20D, 50D, 100D, 200D, 250D
SC.SMPRAT#n	Scale A/D sample rate	5HZ, 6HZ, 10HZ, 12HZ, 20HZ, 25HZ (default), 40HZ, 50HZ, 80HZ, 100HZ
SC.PWRUPMD#n	Power up mode	GO (default), DELAY
SC.TAREFN#n	Tare function	BOTH (default), KEYED, NOTARE, PBTARE
SC.PRI.FMT#n	Primary units format (decimal point and display divisions)	888100, 888200, 888500, 888810, 888820, 888850, 888881 (default), 888882, 888885, 88888.1, 88888.2, 88888.5, 8888.81, 8888.82, 8888.85, 888.881, 888.882, 888.885, 88.8881, 88.8882, 88.8885, 8.88881, 8.88882, 8.88885
SC.PRI.UNITS#n	Primary units	LB (default), KG, OZ, TN, T, G, NONE
SC.SEC.FMT#n	Secondary units format (decimal point and display divisions)	888100, 888200, 888500, 888810, 888820, 888850, 888881, 888882, 888885, 88888.1, 88888.2, 88888.5 (default), 8888.81, 8888.82, 8888.85, 888.881, 888.882, 888.885, 88.8881, 88.8882, 88.8885, 8.88881, 8.88882, 8.88885
SC.SEC.UNITS#n	Secondary units	LB, KG (default), OZ, TN, T, G, NONE
SC.SEC.ENABLED#n	Enable the Secondary Units	ON (default), OFF
SC.FILTERCHAIN#n	Defines what filter to use	AVGONLY (default), RAW
SC.RTZGRAD#n	Number of graduations from the zero base at which the accumulator re-arms itself	0.0–100.0, 0.4 (default)
SC.ACCUM#n	Accumulator enable	OFF (default), ON
SC.WZERO#n	Perform zero calibration	—
SC.TEMPZERO#n	Perform temporary zero calibration	—
SC.LASTZERO#n	Perform last zero calibration	—
SC.WVAL#n	Test weight value	0.000001–999999.999999, 10000.0 (default)
SC.WSPAN#n	Perform span calibration	—
SC.WLIN.F1#n– SC.WLIN.F4#n	Actual raw count value for linearization points 1–4	0–16777215, 0 (default)
SC.WLIN.V1#n– SC.WLIN.V4#n	Test weight value for linearization points 1–4 (A setting of 0 indicates the linearization point is not used)	0.000001–999999.999999, 0.0 (default)
SC.WLIN.C1#n– SC.WLIN.C4#n	Perform linearization calibration on points 1–4	—
SC.LC.CD#n	Zero (deadload) coefficient raw count value	0–16777215, 8386509 (default)
SC.LC.CW#n	Span coefficient raw count value	0–16777215, 2186044 (default)
SC.LC.CZ#n	Temporary zero raw count value	0–16777215, 2186044 (default)
SC.REZERO#n	Perform the Rezero calibration function	—

For commands ending with #n, n is the scale number (1)

Table 7-4. Scales Commands (Continued)

7.5 USB Setting Commands

Command	Description	Values
USB.TRIGGER	USB serial function	CMD (default), STRIND, STRLFT
USB.LINETERM	USB line termination characters	CRLF (default), CR
USB.ECHO	USB echo	ON, OFF (default)
USB.RESPONSE	USB response	ON (default), OFF
USB.EOLDLY	USB end-of-line delay	0–255 (0.1-second intervals), 0 (default)

Table 7-5. USB Port Commands

7.6 EDP Setting Commands

Command	Description	Values
EDP.TRIGGER# <i>p</i>	Port serial function	CMD (default), STRIND, STRLFT
EDP.BAUD# <i>p</i>	Port baud rate	1200, 2400, 4800, 9600 (default), 19200, 38400, 57600, 115200
EDP.BITS# <i>p</i>	Port data bits/parity	8NONE (default), 7EVEN, 7ODD
EDP.TERMIN# <i>p</i>	Port line termination characters	CR/LF (default), CR
EDP.STOPBITS# <i>p</i>	Port stop bits	1 (default), 2
EDP.ECHO# <i>p</i>	Port echo	ON (default), OFF
EDP.RESPONSE# <i>p</i>	Port response	ON (default), OFF
EDP.EOLDLY# <i>p</i>	Port end-of-line delay	0–255 (0.1-second intervals), 0 (default)
For commands ending with # <i>p</i> , <i>p</i> is the port number (1); This is a 1-port device		

Table 7-6. Serial Port Commands

7.7 Stream Setting Commands

Command	Description	Values
STRM.FORMAT# <i>n</i>	Stream format	RLWS (default), CRDNAL, WTRNIX, TOLEDO
For commands ending with # <i>n</i> , <i>n</i> is the stream format number (1)		

Table 7-7. Stream Formatting Commands

7.8 Feature Commands

Command	Description	Values
DATEFMT	Date format **	MMDDYY (default), DDDMMYY, YYMMDD, YYDDMM
DATESEP	Date separator **	SLASH (default), DASH, SEMI, DOT
TIMEFMT	Time format **	12HOUR (default), 24HOUR
TIMESEP	Time separator **	COLON (default), COMMA, DOT
BRIGHTNESS	Brightness of the backlight	OFF, LOW (default), MED, HIGH
AUTOFFTIME	Auto off time	0-60 seconds, 0 =Always On (default)
BATTERYINSTALLED	Power source	NONE, ALK (default)
POWERSAVEMODE	Power save mode	NONE (default), LOW, HIGH
CONSNUM	Consecutive numbering	0–999999, 0 (default)
CONSTUP	Consecutive number start-up value	0–999999, 0 (default)
UID	ID of the indicator	Up to 8 alphanumeric characters, 1 (default)
KYBDLK	Keyboard lock (disable keypad except power)	OFF (default), ON
ZERONLY	Disable all keys except ZERO and power	OFF (default), ON
KHOLDTIME	Key hold time (in tenths of a second); 20 equals 2 seconds	10–50, 20 (default)
KHOLDINTERVAL	Key hold time interval; the amount of time between increments during a key hold (in twentieths of a second); 2 equals a tenth of a second (10 increments per second during a key hold)	1–100, 2 (default)
LOCALE	Enable gravity compensation	OFF (default), FACTOR
GRAV.LOC	Origin gravity factor (in m/s ²) for gravity compensation	9.00000–9.99999, 9.80665 (default)
DEST.GRAV.LOC	Destination gravity factor (in m/s ²) for gravity compensation	9.00000–9.99999, 9.80665 (default)
BATTERYINSTALLED	Installed battery	NONE, ALK, NIMH, LiHiM
** Date/time functions only available with RTC option		

Table 7-8. Feature Commands

7.9 Print Format Commands

Command	Description	Values
GFMT GFMT.PORT	Gross demand print format string	For the .PORT commands, specify the port name as RS232-1, USB, NONE
NFMT NFMT.PORT	Net demand print format string	<i>Example: To send the Gross format out RS-232, send: GFMT.PORT=RS232-1</i>
ACCFMT ACC.PORT	Accumulator print format string	See Section 8.0 on page 49 for information about demand print format strings

Table 7-9. Print Format Commands

7.10 Weigh Mode Commands

These commands function in the weigh mode. Non weight related commands work in setup mode.

Command	Description	Values
P	Returns what the indicator is currently displaying	--
ZZ	Returns what the indicator is currently displaying; as well as an additional number representing the currently displayed annunciators	See Section 10.2 on page 53
CONSNUM	Returns current consecutive number value	0–999999, 0 (default)
UID	Sets or returns the unit ID	Up to 8 alphanumeric characters, 1 (default)
SD	Sets or returns the current system date **	MMDDYY, DDMMYY, YYMMDD, or YYDDMM. Enter six-digit date using the year-month-day order specified for the DATEFMT parameter, using only the last two digits of the year; The current system date is returned by only sending SD
ST	Sets or returns the current system time **	HHMM (enter using 24-hour format) The current system time is returned by only sending ST
STS	Sets or returns the current system time with seconds **	HHMMSS (enter using 24-hour format) The current system time is returned by only sending STS
RS	Resets system	Soft reset; Used to perform a power up reset of the indicator without resetting the configuration to the factory defaults
SX	Starts all serial data streams	--
EX	Stops all serial data streams	--
SX#p	Starts serial data stream for port p	OK or ??
EX#p	Stops serial data stream for port p	An EX command sent while in setup mode does not take effect until the indicator is returned to weigh mode
SF#n	Returns a single stream frame from scale n using the standard Rice Lake format.	--
XA#n	Returns the accumulator value in displayed units	nnnnnnnnn UU
XAP#n	Returns the accumulator value in primary units	
XAS#n	Returns the accumulator value in secondary units	
XG#n	Returns the gross weight in displayed units	nnnnnnnnn UU
XGP#n	Returns the gross weight in primary units	
XGS#n	Returns the gross weight in secondary units	
XN#n	Returns the net weight in displayed units	nnnnnnnnn UU
XNP#n	Returns the net weight in primary units	
XNS#n	Returns the net weight in secondary units	
XT#n	Returns the tare weight in displayed units	nnnnnnnnn UU
XTP#n	Returns the tare weight in primary units	
XTS#n	Returns the tare weight in secondary units	
For commands ending with #n, n is the scale number (1); For commands ending with #p, p is the port number (1)		
** Date/time functions only available with RTC option		

Table 7-10. Weigh Mode Commands

8.0 Print Formatting

The 380/381 provides three print formats, GFMT, NFMT and ACCFMT, which determine the format of the printed output when the **Print** key is pressed. If a tare has been entered or acquired, NFMT is used; otherwise, GFMT is used.

Each print format can be customized to include information, such as company name and address, on printed tickets. The print format is programmed using a combination of print formatting tokens (as in [Table 8-1](#)) and ASCII characters. The configuration may contain a total of up to 300 characters. The output sent to the printer may contain up to 400 characters. Use the print format menu through front panel of the indicator or revolution to customize the print format.



NOTE: Press the down arrow to view the ASCII character decimal value on the second menu level.

NOTE: See [Section 10.6 on page 58](#) to view the ASCII character chart.

8.1 Print Formatting Tokens

[Table 8-1](#) lists tokens which can be used to configure the print formats. Tokens included in the format strings must be enclosed between < and > delimiters. Characters outside of the delimiters are printed as text on the ticket. Text characters can include ASCII characters which can be printed by the output device.

Token	Description
<G>	Gross weight in displayed units
<G/P>	Gross weight in Primary units
<G/S>	Gross weight in Secondary units
<N>	Net weight in displayed units
<N/P>	Net weight in Primary units
<N/S>	Net weight in Secondary units
<T>	Tare weight in displayed units
<T/P>	Tare weight in Primary units
<T/S>	Tare weight in Secondary units
<A>	Accumulated weight in displayed units
<AC>	Number of accumulator events (5 digit counter) **
<AD>	Date of last accumulator event ** ***
<AT>	Time of last accumulator event ** ***
<UID>	Unit ID number (up to 8 characters)
<CN>	Consecutive number (up to 8 numeric digits)
<NLnn>	New line (nn = number of termination (<CR/LF> or <CR>) characters)*
<SPnn>	Space (nn = number of spaces)*
<SU>	Toggle weight data format (formatted/unformatted)
<TI>	Time ***
<DA>	Date (prints 4 digit year) ***
<TD>	Time & Date ***
<nnn>	ASCII character (nnn=decimal value of ASCII character); used for inserting control characters (STX, for example) in the print stream
Gross, net, and tare weights are 9 digits in length, including sign (10 digits with decimal point) followed by a space and a two-digit units identifier. Total field length with units identifier is 12 (or 13) characters.	
For tare weights only, PT is added to the output if the Tare is a Keyed tare, adding 3 additional characters to the total field length.	
UID and consecutive number (CN) fields are up to 8 characters in length.	
* If nn is not specified, 1 is assumed. Value must be in the range 1–99.	
** Accumulator events print 0 unless the accumulator is turned on	
*** Date and time function only available with RTC option installed	

Table 8-1. Print Format Tokens

Table 8-2 lists the default 380/381 print formats:

Format	Default Format String	When Used
GFMT	GROSS<G><NL2>	Weigh mode – no tare in system
NFMT	GROSS<G><NL>TARE<SP><T><NL>NET<SP2><N><NL2>	Weigh mode – tare in system
ACCFMT	ACCUM <A>	Accumulator demand print format string

Table 8-2. Default Print Formats



NOTE: The <G/P>, <N/P> and <T/P> tokens (Table 8-1 on page 49) print the gross, net and tare weights in primary units.

NOTE: The <G/S>, <N/S> and <T/S> tokens (Table 8-1 on page 49) print the gross, net and tare weights in secondary units.

NOTE: The 400 character limit of each print format string includes the output field length of the print formatting tokens, not the token length. For example, if the indicator is configured to display a decimal point, the <G> token generates an output field of 13 characters: the 10 character weight value (including decimal point), one space, and a two-digit units identifier. Configured print format string including tokens is limited to 300 characters.

NOTE: PT (preset tare) is added to the tare weight if tare was keyed in.

8.2 Customizing Print Formats

The GFMT, NFMT and ACCFMT formats can be customized using the print format menu (PF₀₇) via the front panel. See Section 4.3.6 on page 37 for the print format menu structure. To access the print format menu the indicator must be in setup mode (Section 1.3 on page 8).

Using the Front Panel

Use the print format menu to customize the print formats and to edit the print format strings by changing the ASCII characters in the format string. See Section 3.3.2 on page 26 for the alphanumeric entry procedure to edit the print format string.



NOTE: Some characters cannot be displayed on the 380/381 front panel, see the ASCII character chart in Section 10.6 on page 58 for available characters. The 380/381 can send or receive many ASCII characters; the character printed depends on the particular ASCII character set implemented for the receiving device.

8.3 Non-Human Readable Characters


ASCII characters 0 through 31 are non-human readable characters. Since these characters are not visible, they do not appear as selectable options in a 380/381 print format. To include a special character in a print format, the decimal equivalent needs to be used. For example, the special character Esc would be <27> or 60, 50, 55, 62 (less the commas).

Examples of a print release command for a TMU295 in the GROSS format:

Print Format:

GROSS<G><NL2><TD><NL><27>q


In Revolution:

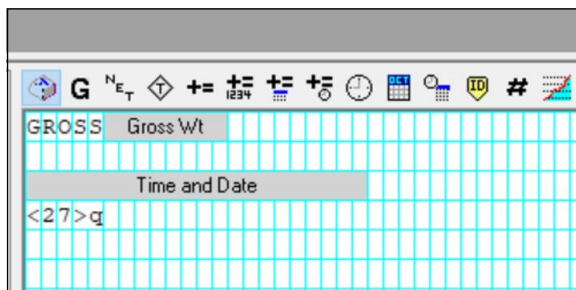

Print Format:

GROSS<G><NL2><TD><NL><27><113>

In Revolution:

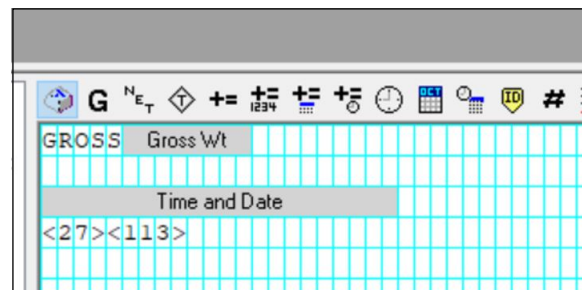

9.0 Maintenance

The maintenance information in this manual is designed to cover aspects of maintaining and troubleshooting the 380/381 indicator. Contact the local Rice Lake Weighing Systems dealer if a problem requires technical assistance.



NOTE: Have the scale or indicator model number and serial number available when calling for assistance.

9.1 Maintenance Checkpoints

The scale must be checked frequently to determine when a calibration is required. It is recommended a zero calibration be checked every other day and a calibration checked every week for several months after installation. Observe the results and change the period between calibration checks, depending upon the accuracy desired.



NOTE: Establish a routine inspection procedure. Report changes in the scale function to the individual or department responsible for the scale's performance.

9.2 Field Wiring

If a problem with the wiring is suspected, check the electrical portion of the scale.

- Check for proper interconnections between the components of the system
- Check wiring meets all specifications in the installation drawings
- Check all wiring and connections for continuity, shorts and grounds using an ohmmeter with the scale off
- Check for loose connections, poor solder joints, shorted or broken wires and unspecified grounds in wiring; these issues cause erratic readings and shifts in weight readings
- Check all cable shields to ensure grounding is made at only the locations specified in the installation drawings

9.3 Troubleshooting

Table 9-1 lists general troubleshooting tips for hardware and software error conditions

Symptom	Possible Cause	Remedy
380/381 does not power up	Discharged Batteries	Test batteries, <ul style="list-style-type: none"> • 380-2D <ul style="list-style-type: none"> – Test each cell; If individual cells are < 1 VDC, or the total is < 4 VDC – replace all batteries • 381-2D-AA <ul style="list-style-type: none"> – Test each cell; If individual cells are < 1 VDC, or the total is < 4 VDC – replace all batteries • 381-2D-NiMH <ul style="list-style-type: none"> – If the battery measures < 5 VDC, plug in the indicator to charge – If Battery depletes rapidly, replace the battery pack.
	Bad power supply	Check power supply; <ul style="list-style-type: none"> • Check presence of AC power – breaker tripped or unit unplugged • 380-2D and 381-2D-AA – power supply outputs around 12 VDC – replace if not • 381-2D-NiMH – charger supplies variable voltage; Voltage starts as 5.8 VDC and increases to over 7 VDC. If this does not happen, charger may need to be replaced
	In Bootmode	Remove and reapply power or fix cause for firmware update failure and repeat update
##### or #####	Over or under range scale condition	Check scale; For out-of-range conditions in total scale display, check all scale inputs for positive weight values
Serial port not responding	Configuration error	Ensure port TRIGGER parameter is set to CMD for command input; Software to check syntax
A/D scale out of range	Scale operation Load cell connection Bad load cell	Check source scale for proper mechanical operation Check load cell and cable connection Check 380/381 operation with load cell simulator Check status of sense settings

Table 9-1. Basic Troubleshooting

9.4 Board Replacement



IMPORTANT: Use anti-static protection for grounding and to protect components from electrostatic discharge (ESD) when working inside the 380/381 enclosure. Procedures requiring work inside the 380/381 must be performed by qualified service personnel only.

To replace a 380/381 board, use the following procedure:

1. Remove the batteries or disconnect the external power to the indicator if being used.



CAUTION: Disconnecting the external power at the 380/381 will activate the batteries if they are installed.

2. Remove front plate as described in [Section 2.5 on page 11](#).
3. Label connections for re-installation to board.
4. Disconnect all connections from the board.
5. Remove the three corner nuts and one standoff securing the board and remove the board.
6. Place the replacement board onto the front plate and secure with previously removed nuts and standoff.
7. Reconnect all connections to the board. See [Figure 2-11 on page 16](#) for details on the board connectors.
8. Replace the front plate and secure the screws as in [Section 2.10 on page 19](#).



IMPORTANT: Always verify indicator has been returned back to a safe state with the proper installation of all connections and a complete functions test before reinstalling the front plate and returning the indicator back to service.

9.5 Updating Firmware

There are two ways to update the firmware; By using the Revolution software and a .bef file or by using a direct connection to the PC and an .exe file.



NOTE: Use Revolution version 3.33 or later.

NOTE: CAL jumper must be removed to update firmware. If CAL jumper is not removed, update will fail and message "The CPU board is in LEGAL state!" will display.

NOTE: Updating firmware defaults configuration settings.


9.5.1 With Revolution

Revolution is used to update the firmware of the 380/381 indicator. The link to begin this process is available on the Revolution home screen. Connect to the indicator as in [Section 6.1 on page 43](#).

9.5.2 Without Revolution



NOTE: All versions of the Synergy indicators use the same 380* firmware.

1. Download the new firmware from www.ricelake.com/380. Package will include two files with filenames that begin with '380_PN202264_Vx.xx'.
2. Connect indicator to computer via one of the following:
 - Micro USB ([Figure 2-11 on page 16](#))
 - Serial connector CN10 on the 380 ([Section 2.8.2 on page 16](#))
 - External RJ11/12 on the 381
3. Turn off indicator.
4. Press and hold  while powering on the indicator. The display will remain off, but if indicator is connected to the PC via the USB, the PC will emit a sound indicating a USB connection to the PC is configured.
5. Run the * .exe file.
6. Select the COM port on the PC that is associated with the USB or RS-232 port.
7. Select Program and wait for **Firmware Updated Successfully** to display. When update process is complete, the 380/381 indicator turns off.

10.0 Appendix

10.1 Error Messages

The 380/381 provides a number of front panel error messages to assist in problem diagnosis. [Table 10-1](#) lists these messages and their meanings.

Error Message	Description
-----	Overflow error – Weight value too large to be displayed
nnnnnnnn	Gross > overload limit – Gross value exceeds overload limit; Check configuration or signal input level; Overload can be caused by input signal > 45 mV or common mode voltage > 950 mV
uuuuuuuu	Gross < underload limit – Gross value exceeds underload limit
ፎፎፎፎፎፎ ስን ስንፎፎፎፎ ስን ስንፎፎፎፎ	Scrolls across display when attempting to perform a tare while weight is in motion, if in motion tares are not allowed
ፎፎፎፎፎፎ ፎፎፎፎፎፎ ፎፎፎፎፎፎ ስን ስንፎፎፎፎ	Scrolls across display when attempting to perform a negative tare, if a negative tare is not allowed
ፎፎፎፎፎፎ ፎፎፎፎፎፎ ስን ስንፎፎፎፎ	Scrolls across display when attempting to perform a keyed tare, if a keyed tare is not allowed
ፎፎፎፎ ስን ስንፎፎፎፎ ፎፎፎፎፎፎ ፎፎፎፎፎፎ ስን ስንፎፎፎፎ	Scrolls across display when attempting to perform a tare larger than capacity, if it is not allowed
ፎፎፎፎ ስን ስንፎፎፎፎ ስን ስንፎፎፎፎ	Scrolls across display when attempting to perform a tare if a tare is already in the system, if tare is not configured to replace or remove
ስን ስንፎፎፎፎ ፎፎፎፎፎፎ ፎፎፎፎፎፎ	Scrolls across display when an attempt to perform an initial zero fails, only possible at startup
PLEASE ስን ስን	Scrolls across display when calibrating

Table 10-1. Error Messages

10.2 ZZ EDP Command

The ZZEDP command can be used to remotely query whatever is being displayed on the LCD Display, along with a decimal number representing the annunciators currently lit. The format on the returned value is WWWWWW UU NNN in weight display modes, and VVVVVV NNN in non-weight display modes. NNN is a number between 0 and 4095, and is the sum of values representing the different annunciators ([Table 10-2](#)).

Example: If the annunciator status value returned for the ZZ command is 0145, the gross, standstill and lb annunciators are on. The number 0145 represents the sum of the values for the gross mode annunciator (16), the standstill annunciator (128) and the lb annunciator (1).

Decimal Value	Annunciator
1	lb units
2	kg units
4	Tare entered
8	Keyed tare entered
16	Gross
32	Net
64	Center of zero
128	Standstill
256	oz units
512	tn units
1024	t units
2048	g units

Table 10-2. Status Codes Returned on the ZZ Command



NOTE: Standstill bit is set when the In-Motion annunciator is NOT lit.

10.3 Continuous Data (Stream) Output Formats

When the trigger setting for a port is set to STRIND or STRLFT, data is continuously streamed from the appropriate port in one of the four fixed format options.

Fixed Format Options:

- Rice Lake Weighing Systems (Section 10.3.1)
- Cardinal (Section 10.3.2)
- Avery Weigh-Tronix (Section 10.3.3 on page 55)
- Mettler Toledo (Section 10.3.4 on page 55)

10.3.1 Rice Lake Weighing Systems Stream Format (rL5)

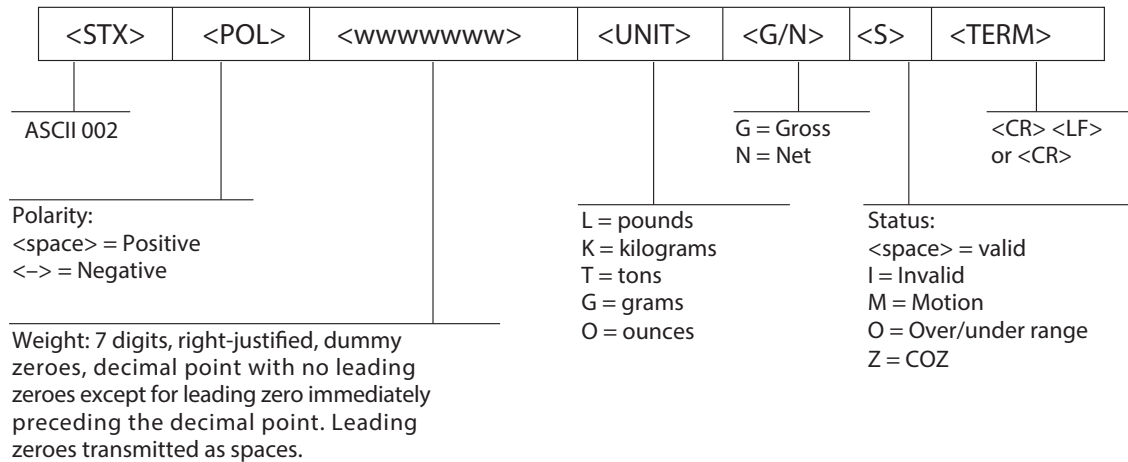


Figure 10-1. Rice Lake Weighing Systems Stream Data Format

10.3.2 Cardinal Stream Format (rLnRL)

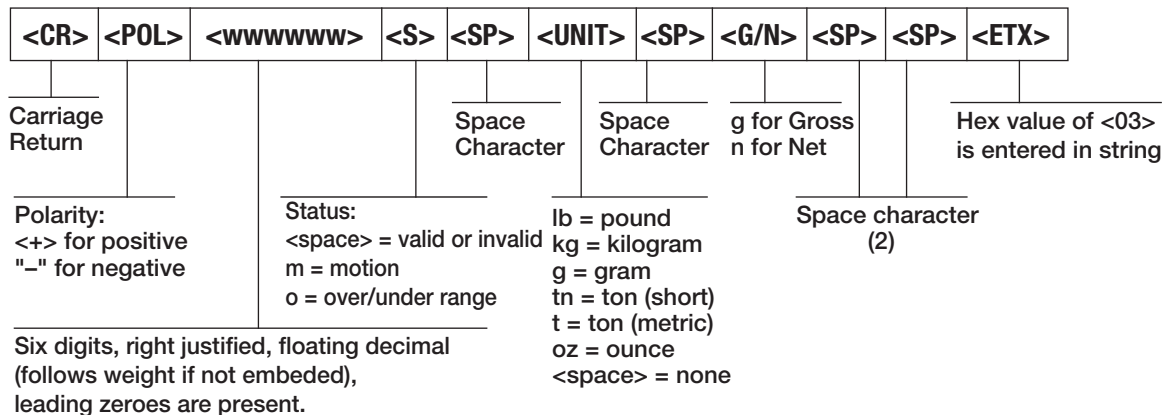


Figure 10-2. Cardinal Stream Data Format

10.3.3 Avery Weigh-Tronix Stream Format (αβγδϵ)

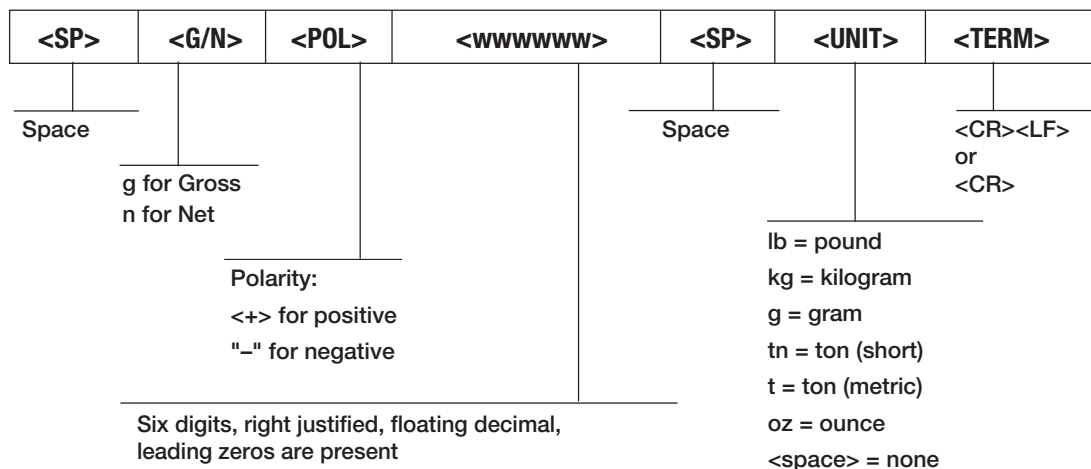


Figure 10-3. Avery Weigh-Tronix Stream Data Format

10.3.4 Mettler Toledo Stream Format (αβγδϵζη)

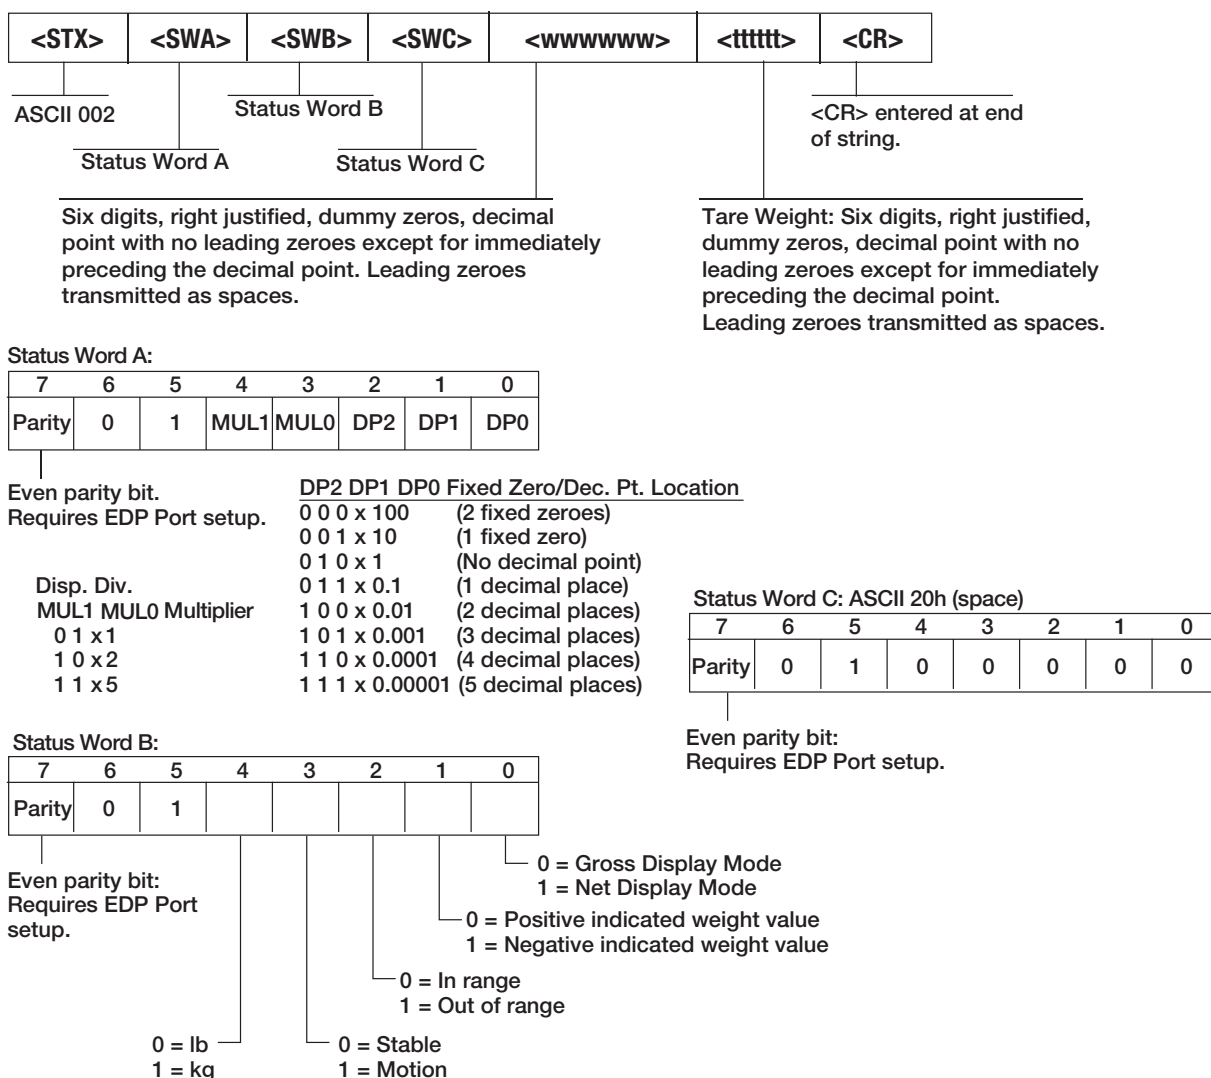


Figure 10-4. Mettler Toledo Stream Data Format

10.4 Conversion Factors for Secondary Units

The 380/381 has the capability to mathematically convert a weight into another unit of measurement and display the result with the press of the Units key. Available units are pounds (lb), kilograms (kg), tonnes (t), grams (g), short ton (tn) and ounces (oz). Secondary units can be specified on the Format menu using the **SECNDR** parameter.



NOTE: Multipliers are preconfigured within the indicator.

NOTE: Ensure the secondary decimal point position is set appropriately for the scale capacity in the secondary units.

10.5 Digital Filtering

Digital filtering is used to create a stable scale reading in challenging environments. The 380/381 allows selection of **Digital Rolling Average Filtering** (Section 10.5.1) or **RAW** (no filtering). See Section 4.3.1 on page 33 for configuration menu layout and the location of **FLTCHN** parameter.

The scale's sample rate effects all types of filtering. The A/D sample rate is selected by the **SMPRAT** scale parameter. The A/D sample rate is the number of weight readings the indicator takes per second (**SMPRAT**). This can be 5, 6, 10, 12, 20, 25, 40, 50, 80, or 100 hertz (readings per second). Set the A/D sample rate to the lowest setting required for the application. Lower settings result in better stability.

10.5.1 Digital Rolling Average Filter (AVGONLY)

The digital rolling average filter uses mathematical averaging with three stages. These configurable stages control the effect of a single A/D reading on the displayed weight. When an A/D reading outside of a predetermined band (defined by the **DFSENS** and **DFTHRH** parameters) is encountered, the digital rolling average filter is overridden and the display jumps directly to the new value.

Digital Filter Stages (DGFLTR1-3)

The filter stages can each be set to a value of 1–256. The value assigned to each stage sets the number of readings received from the preceding filter stage before averaging. Setting the filter stages to 1 effectively disables the rolling filter.

A rolling average is passed to successive filtering stages for an overall filtering effect which is effectively a weighted average of the product of the values assigned to the filter stages ($DGFLTR1 \times DGFLTR2 \times DGFLTR3$) within a time frame corresponding to the sum of the values ($DGFLTR1 + DGFLTR2 + DGFLTR3$).

Digital Filter Sensitivity (DFSENS) and Threshold (DFTHRH)

The rolling averaging filter can be used by itself to eliminate vibration effects, but heavy filtering also increases settling time. The **DFSENS** and **DFTHRH** parameters can be used to temporarily override filter averaging and improve settling time.

- **DFSENS** specifies the number of consecutive A/D readings which must fall outside the filter threshold (**DFTHRH**) before filtering is suspended
- **DFTHRH** sets a controlling threshold delta value, in display divisions; the indicator monitors both the incoming filtered and unfiltered A/D values; **DFTHRH** is the maximum allowable difference between the filtered and unfiltered A/D values for which the filter will remain engaged; filtering is suspended when the difference between the filtered and unfiltered A/D values is greater than the **DFTHRH** value for more than the specified number (**DFSENS**) of consecutive readings; filtering is reengaged when two consecutive A/D readings are within the **DFTHRH** threshold delta value; Set **DFTHRH** to **NONE** to turn off the filter override

Digital Rolling Average Filter Procedure

1. In setup mode, set the rolling filter stage parameters (**DGFLTR1-3**) to 1.
2. Set **DFTHRH** to **NONE**.
3. Return to weigh mode.
4. Remove all weight from scale, then watch the indicator to determine the magnitude of vibration effects on the scale.
5. Record weight below which all but a few readings fall. This value is used to calculate the **DFTHRH** parameter in [step 8](#).
Example – if a heavy-capacity scale (10000 x 5 lb) produces vibration-related readings of up to 50 lb, with occasional spikes up to 75 lb, record 50 as the threshold weight value.
6. Place the indicator in setup mode and set the filter stage parameters (**DGFLTR1-3**) to eliminate the vibration effects on the scale (leave **DFTHRH** set to **NONE**).
7. Find the lowest effect value for the **DGFLTR1-3** parameters.

If needed, the digital filter cutout sensitivity (**DFSENS**) and the digital filter cutout threshold (**DFTHRH**) can be used to reset the digital rolling average filter so the response to a rate change is faster.

8. Calculate the **DFTHRH** parameter value by converting the weight value recorded in [step 5](#) to display divisions (**Threshold_Weight_Value / Display_Divisions**).

*In the example in [step 5](#), with a threshold value of 50, and a display divisions value of 5, set the **DFTHRH** parameter to 10 display divisions.*

9. Set the **DFSENS** parameter high enough to ignore transient peaks. Longer transients (typically caused by lower vibration frequencies) causes more consecutive out-of-band readings; set the **DFSENS** parameter higher to counter low frequency transients.

10.5.2 Regulatory Mode Functions

Regulatory Parameter	Weight On Scale	Tare In System	Front Panel Key Tare	Front Panel Key Zero
NTEP	Zero	No	"000000"	Zero
		Yes	Clear tare	Zero
	Negative	No	No action	Zero
		Yes	Clear tare	Zero
	Positive	No	Tare	Zero
		Yes	Tare	Zero
Canada	Zero	No	"000000"	Zero
		Yes	Clear tare	Clear tare
	Negative	No	No action	Zero
		Yes	Clear tare	Clear tare
	Positive	No	Tare	Zero
		Yes	No action	Clear tare
OIML	Zero	No	"000000"	Zero
		Yes	Clear tare	Zero and Clear tare
	Negative	No	No action	Zero
		Yes	Clear tare	Zero and Clear tare
	Positive	No	"000000"	Zero
		Yes	Tare	Zero and Clear Tare
None	Zero	No	"000000"	Zero
		Yes	Clear tare	Clear tare
	Negative	No	No action	Zero
		Yes	Clear tare	Clear tare
	Positive	No	Tare	Zero
		Yes	Clear tare	Clear tare

Table 10-3. Tare and Zero Key Functions for REGULA Parameter Settings

10.6 ASCII Character Chart

Use the decimal values for ASCII characters listed in [Table 10-4](#) when specifying print format strings on the 380/381 PFORMAT menu ([Section 4.3.6 on page 37](#)). The actual character printed depends on the character mapping used by the output device.

The 380/381 can send or receive ASCII character values (decimal 0–255), but the indicator display is limited to numbers, uppercase, unaccented letters and a few special characters. See [Section 10.7 on page 59](#) for information about the 380/381 LCD display.

Control	ASCII	Dec	Hex	ASCII	Dec	Hex	ASCII	Dec	Hex	ASCII	Dec	Hex
Ctrl-@	NUL	00	00	space	32	20	@	64	40	`	96	60
Ctrl-A	SOH	01	01	!	33	21	A	65	41	a	97	61
Ctrl-B	STX	02	02	"	34	22	B	66	42	b	98	62
Ctrl-C	ETX	03	03	#	35	23	C	67	43	c	99	63
Ctrl-D	EOT	04	04	\$	36	24	D	68	44	d	100	64
Ctrl-E	ENQ	05	05	%	37	25	E	69	45	e	101	65
Ctrl-F	ACK	06	06	&	38	26	F	70	46	f	102	66
Ctrl-G	BEL	07	07	'	39	27	G	71	47	g	103	67
Ctrl-H	BS	08	08	(40	28	H	72	48	h	104	68
Ctrl-I	HT	09	09)	41	29	I	73	49	i	105	69
Ctrl-J	LF	10	0A	*	42	2A	J	74	4A	j	106	6A
Ctrl-K	VT	11	0B	+	43	2B	K	75	4B	k	107	6B
Ctrl-L	FF	12	0C	,	44	2C	L	76	4C	l	108	6C
Ctrl-M	CR	13	0D	-	45	2D	M	77	4D	m	109	6D
Ctrl-N	SO	14	0E	.	46	2E	N	78	4E	n	110	6E
Ctrl-O	SI	15	0F	/	47	2F	O	79	4F	o	111	6F
Ctrl-P	DLE	16	10	0	48	30	P	80	50	p	112	70
Ctrl-Q	DC1	17	11	1	49	31	Q	81	51	q	113	71
Ctrl-R	DC2	18	12	2	50	32	R	82	52	r	114	72
Ctrl-S	DC3	19	13	3	51	33	S	83	53	s	115	73
Ctrl-T	DC4	20	14	4	52	34	T	84	54	t	116	74
Ctrl-U	NAK	21	15	5	53	35	U	85	55	u	117	75
Ctrl-V	SYN	22	16	6	54	36	V	86	56	v	118	76
Ctrl-W	ETB	23	17	7	55	37	W	87	57	w	119	77
Ctrl-X	CAN	24	18	8	56	38	X	88	58	x	120	78
Ctrl-Y	EM	25	19	9	57	39	Y	89	59	y	121	79
Ctrl-Z	SUB	26	1A	:	58	3A	Z	90	5A	z	122	7A
Ctrl-[ESC	27	1B	;	59	3B	[91	5B	{	123	7B
Ctrl-\	FS	28	1C	<	60	3C	\	92	5C		124	7C
Ctrl-]	GS	29	1D	=	61	3D]	93	5D	}	125	7D
Ctrl-^	RS	30	1E	>	62	3E	^	94	5E	~	126	7E
Ctrl-_	US	31	1F	?	63	3F	_	95	5F	DEL	127	7F

Table 10-4. ASCII Character Chart




10.7 Front Panel Display Characters

Refer to [Figure 10-5](#) for the seven-segment LCD character set used on the 380/381 front panel display for alphanumeric characters.

!		7		Ff		Ss	
"		8		Gg		Tt	
+		9		Hh		Uu	
-		:		li		Vv	
.		;		Jj		Ww	
/		<		Kk		Xx	
0		=		Ll		Yy	
1		>		Mm		Zz	
2		Aa		Nn		[
3		Bb		Oo		\	
4		Cc		Pp]	
5		Dd		Qq		_	
6		Ee		Rr			

Figure 10-5. Display Characters

11.0 Compliance

	EU DECLARATION OF CONFORMITY <small>EU-KONFORMITÄTSEKTLÄRUNG DÉCLARATION UE DE CONFORMITÉ</small>		Rice Lake Weighing Systems 230 West Coleman Street Rice Lake, Wisconsin 54868 United States of America
			
Type/Typ/Type: 380 indicator series			
English	We declare under our sole responsibility that the products to which this declaration refers to, is in conformity with the following standard(s) or other regulations document(s).		
Deutsch	Wir erklären unter unserer alleinigen Verantwortung, dass die Produkte auf die sich diese Erklärung bezieht, den folgenden Normen und Regulierungsbestimmungen entsprechen.		
Français	Nous déclarons sous notre responsabilité que les produits auxquels se rapporte la présente déclaration, sont conformes à la/aux norme/s suivante ou au/aux document/s normatif/s suivant/s.		
EU Directive	Certificates	Standards Used / Notified Body Involvement	
2014/35/EU LVD	-	IEC 62368-1:2014	
2014/30/EU EMC	-	EN 61326-1:2013, EN 61000-3-2:2014, EN 61000-3-3:2013	
2014/53/EU RED	-	EN 300 328:2019, EN 301 489-17:2020	
2011/65/EU RoHS	-	EN 50581:2012	
Signature:			Place: Rice Lake, WI USA
Name:	Brandi Harder		Date: September 17, 2021
Title:	Quality Manager		

UK CA

UK DECLARATION OF CONFORMITY

Rice Lake Weighing Systems
230 West Coleman Street
Rice Lake, Wisconsin 54868
United States of America

RICE LAKE
WEIGHING SYSTEMS

Type: 380 indicator series

English We declare under our sole responsibility that the products to which this declaration refers to, is in conformity with the following standard(s) or other regulations document(s).

UK Regulations	Certificates	Standards Used / Approved Body Involvement
2016/1101 Low Voltage	-	IEC 62368-1:2014
2016/1091 EMC	-	EN 61326-1:2013, EN 61000-3-2:2014, EN 61000-3-3:2013
2017/1206 Radio	-	EN 300 328:2019, EN 301 489-17:2020
2012/3032 RoHS	-	EN 50581:2012

Signature: Brandi Harder

Place: Rice Lake, WI USA

Name: Brandi Harder

Date: March 7, 2022

Title: Quality Manager

12.0 Specifications

380-2D (PN 202711)

Power

Four Alkaline C-Cell Batteries
Optional 115/230 VAC to 12 V adapter

Power Consumption

8.5 W max with optional external power adapter

Battery Life

100 hours on Alkaline batteries with one 350 Ω load cell, no backlight
45 hours on Alkaline batteries with four 350 Ω load cells, low backlight
20 hours on Alkaline batteries with eight 350 Ω load cells, low backlight

Excitation Voltage

5 VDC, 8 x 350 Ω or 16 x 700 Ω load cells

Analog Signal Input Range

-0.3 mV to +30 mV
Common Mode Voltage 0.7 V to 3.3 V

Analog Signal Sensitivity

1 μ V/graduation recommended

A/D Sample Rate

Software Selectable (Hz)
5, 6, 10, 12, 20, 25, 40, 50, 80, 100

Resolution

Internal: 8,000,000 counts
Display: 100,000

System Linearity

Within 0.01% full scale

Communication Ports

One RS-232 (three-wire)
One USB 2.0

Status Annunciators

g, lb, t, tn, kg, oz, battery level, PT, LT, gross, zero, unstable, net

Display

Six 1.0 in (25 mm) tall, LCD digits

Keys / Buttons

Five tactile buttons

Dimensions (L x W x H)

11.58 x 74.53 x 8.57 in (294 x 115 x 218 mm)

Temperature Range

Legal: 14–104°F (-10–40°C)
Industrial: 14–122°F (-10–50°C)

Rating/Material

Rating: IP66
Material: Stainless Steel

Warranty

Two-year limited warranty

EMC Immunity

10 V/m

Certifications and Approvals

380 Universal



NTEP

CoC Number: 21-051A1
Accuracy Class: III / III L; n_{max} : 10000



Measurement Canada

Approval Number: AM-6184
Accuracy Class: III / III HD; n_{max} : 10000



UL

File Number: E151461



381-2D-AA (PN 215695) / 381-2D-NiMH (PN 215696)**Power**

Battery: AA or Nickel Metal Hydride (niMH)
 381-2D-AA Adapter: 115/230 VAC to 12 VDC
 381-2D-NiMH Charger: 115/230 VAC

Power Consumption

AA: input 0.8 A
 NiMH: input of 0.35 A

Battery Life

AA: 40 hours with 1 x 350 ohm load cell
 NiMH: 80 hours with 1 x 350 ohm load cell

Excitation Voltage

5 VDC, 8 x 350Ω or 16 x 700Ω load cells

Analog Signal Input Range

-0.3 mV to +30 mV
 Common Mode Voltage 0.7 V to 3.3 V

Analog Signal Sensitivity

1 μV/graduation recommended

A/D Sample Rate

Software Selectable (Hz)
 5, 6, 10, 12, 20, 25, 40, 50, 80, 100

Resolution

Internal: 8,000,000 counts
 Display: 100,000

System Linearity

Within 0.01% full scale

Communication Ports

One RS-232 (three-wire)
 One USB 2.0

Status Annunciators

g, lb, t, tn, kg, oz, battery level, PT, LT, gross, zero, unstable, net

Display

Six 1.0 in (25 mm) tall, LCD digits

Keys / Buttons

Five tactile buttons

Dimensions (L x W x H)

8.50 x 3.17 x 5.06 in (215.8 x 80.5 x 128.5 mm)

Temperature Range

Legal: 14–104°F (-10–40°C)
 Industrial: 14–122°F (-10–50°C)

Rating/Material

AA Battery: IP54, ABS
 NiMH Battery: IP66, ABS

Warranty

Two-year limited warranty

EMC Immunity

10 V/m

Certifications and Approvals**NTEP**

CoC Number: 21-051A1
 Accuracy Class: III/IIIL; n_{max}: 10000

**Measurement Canada**

Approval Number: AM-6184
 Accuracy Class: III/IIHD; n_{max}: 10000





© Rice Lake Weighing Systems Specifications subject to change without notice.

230 W. Coleman St. • Rice Lake, WI 54868 • USA

U.S. 800-472-6703 • Canada/Mexico 800-321-6703 • International 715-234-9171 • Europe +31 (0)26 472 1319